

Remington Arms Co., Inc.
Product Service
Legal Case #:7495

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
261375	3/12/2012	3/19/2012	3/19/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Tom	Hohlweck	W 170 N 11449 Armada Dr.	Germantown	WI	53022		H 414-801-1700

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006	Altered Adjustments or Components		
S	Unexplained Discharge	Concern:1025	Unexplained Discharge - No Mention of Safety Position	Unknown
C				

Customer sent gun into Ilion. Customer stated gun went off while unloading. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	600/308 WIN	n/a	A6437771	CO	4/21/1977
Date Purchased	Where Purchased	Accessories	Original Owner			
	CENTRAL SALES MILWAUKEE WI		U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Repair @ n/c - recall			Remington/600/CF/BA			
	Repair/Replacement Cost	Repair/Replacement Date				
	\$111					

3/21/12: Per Ilion - Could not duplicate concern. TA dirty & sticky. Bolt stop sluggish. Number on bolt does not match. Replace TA, clean & test fire under recall @ n/c. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		3/19/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	NUMBER ON BOLT DOES NOT MATCH SER. NUMBER
Barrel	Description		18.5" 308 WIN
	Date Code		CO
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	SLUGGISH
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/600 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.007
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY,STICKY
	Pull	---Select---	3.5#
	Altered	True	SEALANT MISSING FROM PULL SCREW
	Sub-Assembly	Other Remington	

frmREInquiry - Repair Inquiry

Repair Number: RE00261375

Serial: A6437771 Model 600 MOHAWK Center Fire
Caliber: 308 WIN Produced: 04/21/1977 SKU: 20000

Repairman: Charles Swanson

Verify Repair

Status: Estimating 3/17/2012 11:59:13 AM

7495

ADDRESS INFORMATION

Customer		Received from	Return To	Received from	
Name:	TOM HOHLWECK		TOM HOHLWECK		
Address 1:	W 170 N 11449 ARMADA DR		W 170 N 11449 ARMADA DR		
Address 2:		PO Box:		PO Box:	
City:	GERMANTOWN		GERMANTOWN		
State:	WI	Zip Code:	53022	Country:	US

FFL: 01011900

Contact / Condition Problems Estimate History / Status Shipping / Billing

Problems Reported

Code	Desc
M100	SEE CUSTOMERS LETTER

Problems Found

Code	Desc
M123	FORWARD TO PRODUCT SE...

Repair Notes

RECEIVED
MAR 21 2012
BY: [Signature]

Repairman's Comments

could not duplicate concern
T.A. dirty + sticky Bolt stop Sluggish
NUMBER 00 Bolt does not match.
replace TPA clear test under recoil
B + H/C #230148

CSR Comments

GUN WENT OFF WHEN WHILE UNLOADING.

Refresh

Close

Serial Number:

A6437771

Model: 600 MOHAWK



RE00261375

17.5
CO 4/77
3.54
1007