Remington Arms Co., Inc. Product Service Legal Case #:8268

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete 12/4/2012

291253 12/3/2012 12/4/2012

X

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact

Incident

Clyde

27452 Mountain Valley Rd Millboro VA 24460

E cchively@mgwnet.com

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

PD

Cause:4054 As received Follows Down

S Fired on safety release

Concern:1007 Fired on Safe Release

Unknown

12/21/12 Per note with rifle,

Firearm Information

Mfg.

Type

Model/Ga.

SKU

Serial Bbl.

DOM

Remington

CF/BA

660/243 WIN

n/a

109412 CR 4/1/1968

Date Purchased

Where Purchased

Accessories

Original Owner U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/660/CF/BA

Settlement

Release of Claims

Release Date

Reimbursement

Cash Settlement Reim. Cash

Date Date APV APV

Per Ilion, replace TPA, clean and test at no charge under recall

Repair/Replacement Repair/Replacement

Cost

Date

43.81

12/21/2012

12/21/12 Per Ilion, replace TPA, clean and test at no charge under recall.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		12/4/2012
Examination	Product Type		RF
	Action Type		A
	Assigned To		J.BALIO
Cause	4054	As received Follows Down	
	Description]	20" 243 WIN

ı		╡	
Barrel	Date Code		CR
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	.007
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	WILL FOLLOW DOWN ON SAFETY NULL TEST
	Pull	Select	3#
	Altered	False	
	Sub-Assembly	Other Remington	

Madison, NC 27025-0700

Parts aild Repairs: P:800-243-9700 F:336-548-7801

www.Remington.com

This document is a nominary of your request for service. Please review the document for accuracy and to insize the services you are requesting are noted. This nformation will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCUMENT WITH YOUR RETURN.

7011 C124/68

Serice Request Number

Serial Number / Description

SR00036553

Model

Customer:

CLYDEHIVELY 27452 MOUNTAIN VALLEY ROAD MILLBORO, VA 24450 US

Date of Request: Date Printed:

11/28/2012 11-28:2012

Destination:

Arms Services 14 Hoefler Ave

Rien, NY 13357 US

Email: cchively@mgwnet.com

Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M240 - BOLT LOCK SAFETY MODIFICATION

Service Request Section

wants safety modification

Qiv Needed

Warranty

Disc Amount

Rep. TPA, cleans Kest At N/c unden le en 11.

#230145

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Sub Total: Est Sales Tax: .00 .00

Grand Total:

\$.00

						
Model Number: Model 660	Serial Number: 109412					
Name: Clyde C. Hively, Jr.	Date of Purchase: 1970-1971					
Address (no PO Boxes): 27452 Mtn. Valley Rd.						
City: Millboro	State: VA	Zip: 24460				
Phone (Daytime): 540/996-4185	Fax:					
E-mail Address: cchively@mgw	net.com					
Please describe your problem:						
discharge when safety is released without trigger pull. My rifle did this one time and scared me badly. I purchased rifle new in the box about 1970, no V showing on the left side of trigger, blot is locked when safety is on, and did fire once without trigger pull. Seems it is a candidate for repair. I understand that you will check rifle, change safety so bolt can be opened with safety on or off, and possibily replace trigger. 6 characters left						
		`antar for annings				
NOTE: Prior to shipping your firearm, cor provided and estimate		enter for services				
WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM. :: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.) :: Remove all accessories from your firearm to prevent loss or damage. :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss during shipment, so you may elect to purchase insurance from your carrier.						
Print						