

Remington Arms Co., Inc.
Product Service
Legal Case #:7740

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
272360	6/18/2012	6/19/2012	6/19/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Bruce F	Brockett	17373 State Hwy 305 NE	Poulsbo	WA	98370		

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	Sometimes fires when bolt is closed	Concern:1008 Fired on Bolt Closing		
C				

6/25/12 Per note with firearm, sometimes fires when bolt is closed. It has been doing it for a long time.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	6681481	BX	1/1/1973
Date Purchased	Where Purchased	Accessories	Original Owner			
	CHAS GREENBLAT HEMPSTD LI NY	SCOPE BASE	U			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test at BLSM price						
Repair/Replacement Cost	Repair/Replacement Date					
29.44	6/25/2012					

6/25/12 Per Ilion, trigger assm has a partially dried and sticky lube residue causing parts to work sluggish. Replace TPA, clean, test at BLSM price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		6/19/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4015	Improper Maintenance	
Barrel	Description		22" 3006 SPRG
	Date Code		BX
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	SLUGGISH
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.006
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	STICKY LUBE RESIDUE PARTS WORK SLUGGISH WILL FOLLOW DOWN
	Pull	---Select---	4.5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE BASE

7740

22"
B+1/83
4.5#

1006

INCIDENT 120601-000049

BRUCE F. BROCKETT

17373 STATE HWY 305 NE

POULSBORO, WA 98370

S/N 6681481

Sometimes fires when bolt
is closed - periodic. Been
doing it for a long time.

RECEIVED
JUN 22 2012

BY:.....

T.A. has a partially dried +
sticky lube residue causing
parts to work sluggish.
Replace TPA, clean + test
under BLP Con 8 20. +

Serial
Number:

6681481

Model: 700



RE00272360

Quote







