

Remington Arms Co., Inc.
Product Service
Legal Case #:8366

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
292403	12/11/2012	12/17/2012	12/17/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Deadeye Gun & Pawn		Deadeye Gun & P	7483 State Hwy 14 E	Sparta	MO	65753		W 417-634-0343

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI PD S C	Cause:4038 Fired when releasing the safety Concern:1007 Fired on Safe Release	Could Not Duplicate Concern	Unknown	

12/28/12 Per letter with rifle, while out hunting he had taken a shot, cycled a new round, attempted to move the safety lever back into the safe position and the lever would not move back to safe. He opened the bolt, removed the live round and was able to move it to safe. He then chambered a new round with the safety on and with a live round in the chamber he moved the safety lever to fire and the gun discharged. He has been able to duplicate it several times.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/7MM REM MA	26263	T6239729	LS	2/26/1998
Date Purchased	Where Purchased	Accessories	Original Owner			
	ZANDERS SPORTING GOODS * GLEN	SLING	Y			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, can offer to replace TPA, clean, test at 1/2 charge to restore confidence						

Repair/Replacement Cost	Repair/Replacement Date

12/28/12 Per Ilion, could not duplicate concern. Can offer to replace TPA, clean, test at 1/2 charge to restore confidence in rifle.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS

Examination	Exam Date	12/17/2012	
	Product Type	RF	
	Action Type	A	
	Assigned To	J.BALIO	
Cause	4038	Could Not Duplicate Concern	
Barrel	Description	24" 7MM REM MAG SS	
	Date Code	LS	
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
Bolt	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Magazine	Condition	---Select---	
	Box Condition	Missing	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description	STANDARD SAFETY	
	Function	Like new; Functioning	
Sear	Lift	---Select---	
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	
	Pull	---Select---	
	Altered	False	
	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description	SLING	

8366

2411
152/98
4.5
1015

While I was out hunting with my rifle I had taken a shot, cycled a new round into the chamber, attempted to move the safety lever back into the safety position and the lever would not move back to "safe". I opened the bolt, removed the live round and then tried to move the lever again and it moved back to the "safe" position. I switched the lever multiple times from fire to safe multiple times and then chambered a new round with the safety in the "safe" position. With a live round in the chamber I moved the safety lever into the "fire" position and the gun discharged. I have replicated these steps multiple times and have duplicated the result multiple times. ~~over~~
I have never had any custom trigger work done on this rifle since I purchased it new in 1998.



Serial
Number:

T6239729

Model: 700



RE00292403

Could not disp. CONCERN
CAN often to rep. TPA, clean
and test at 1/2 charge to
restore cork, hence in rifle

Q

RECEIVED
DEC 19 2012

BY:.....





