PrintDisplay Page 1 of 2

> Remington Arms Co., Inc. Product Service Legal Case #:7272

Case Information

Date Opened(PS) RE# Date Opened **Date Closed** Incident Date Pre Lit Lit Obsolete 254270 1/13/2012 1/16/2012 1/16/2012

Customer Information

Type Business First Name Last Name Street City State Zip Contact Elliott 2153 Century Rd Richard Incident Piedmont AL 36272 E dozerpel@gmail.com

Incident Information

Claims Repair Est. Medical Treatment Medical Status Codes

PΙ

PD Cause: 4006 Altered Adjustments or Components Concern: 1007 Fired on Safe Release

Unknown

S Fired on safety release

1/26/12 Per note on SR, fire when taking off safety.cm

Firearm Information

SKU Serial Bbl. DOM Mfg. Type Model/Ga. F6215508 WW 8/8/2002 10:19:35 PM Remington CF/BA 700/3006 SPRG 25955

Date Purchased Where Purchased Accessories Original Owner

WAL-MART DC 6003R-REGULAR U

CONCERN: FSR

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Cash Cash Date Reim. Settlement Release of Claims Release Date Reimbursement Settlement Date APV APV

Per Ilion, replace TPA, clean and test fire at 1/2 normal cost

Repair/Replacement Repair/Replacement Cost Date

Per Ilion, trigger assm dirty and rusty. Set screws altered. Trigger not returning. Replace TPA, clean and test fire at 1/2 normal cost.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/16/2012
	Product Type]	RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
Ватеі	Description		22" 3006 SPRG
	Date Code]	ww
	Bore Plugged	False	
	Bulged	False	
	Fired	False]
	Fired while Obstructed		_
	Muzzle/Crown Condition	Slightly Worn; Functioning	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7272&Type=Case

 
1/26/2012

Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning]`
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Not Functioning] .
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning] .
	Bulged	False	· ·
Safety	Description		M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.011
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,RUSTY,TRIG NOT RETURNING WILL FOLLOW DOWN
	Pull	Select	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	

Service Request

Remington Service

Madison, NC 27025-0700





This document is a summary of your request for service. Please review the document for accuracy and to misting the service and complete service. ENCLOSE THIS DOC1 Service Request Numberrial Number / Description

SR00007051

F6215508

Model 700 RIFLE

Customer: RICHARD ELLIOTT 2153 CENTURY RD

PEIDMONT, AL 36272 US

Email: dozerpel @gmail.com

Date of Requesti2/19/2011 Printed: 2/19/2011 Date

Destination: Arms Services 14 Hoefler Ave Hion, NY 13357 US

Email:

Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be rep returned. If not, you will be contacted with an estimate before work is performed.

Regson For Return M123 - FORWARD TO PRODUCT SERVICE FOR INSPECTION

Service Request Section

fire when putting gun ox saftey

bff

Parts And Service Details

Material Type Description

Qty Needed

Warranty

Price Disc Amount

輩F6215508

1/20 Oropped prece of TRA as goodwill. Bought endhand. T.A. diply + Rusty. Sct screws Altered. Thing. Not inturwing. replace Tith, chant test four AT 1/2,000,000 = 08T

JAN 1 8 2012

Sub Total: Est Sales Tax: .00 .00

BY:.

Grand Total:

\$.00