Page 1 of 2 PrintDisplay

> Remington Arms Co., Inc. Product Service Legal Case #:7900

Case Information

RE# Date Opened 280583 8/30/2012

Date Opened(PS) 8/31/2012

Date Closed 8/31/2012

Incident Date

Pre Lit Lit Obsolete

Customer Information

Type Business First Name Last Name

Fanst

Street

State Zip City

Contact

Incident

Michael

580 Stage Coach Rd SE

NM 87124 Rio Rancho

E mikell40@yahoo.com

Incident Information

Claims

Codes

Repair Est. Medical Treatment Medical Status

PΙ

PD

Cause: 4006 Altered Adjustments or Components

S Fired when closing bolt

Concern:1008 Fired on Bolt Closing

Unknown

9/20/12 per note on SR, consumer states that the firearm is going off when they close the bolt.cm

Firearm Information

Mfg. Remington

Type CF/BA

Model/Ga. 700/17 REM

SKU 25801 Serial

DOM

Date Purchased

Where Purchased

Accessories

Original Owner

Bbl. C6531248 4/22/1990 CK

JOHNS SPORTING GOODS

U

CONCERN: FBC

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Release of Claims

Release Date

Reimbursement

Cash Settlement Reim. Date Cash Date APV APV

Settlement Per Ilion, replace TPA, clean, test at 1/2 normal cost

Repair/Replacement Repair/Replacement Cost

Date

9/20/12 Per Ilion, trigger assm set screws altered, very dirty. Connector is broken. Replace TPA, clean, test at 1/2 normal cost.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		8/31/2012
	Product Type		RF
	Action Type		Α
	Assigned To]	T.NAGLE
Cause	4006	Altered Adjustments or Components	
Barrel	Description		24" 17 REM
	Date Code]	CK
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	\neg

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7900&Type=Case

9/20/2012

Bolt	Face	Worn; Functioning	
	Handle		
		Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	<u> </u>
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Scleat	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		STANDARD SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	Select	N/A
Sear	Notch	Slightly Worn; Functioning	DIRTY
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	VERY DIRTY CONNECTOR BROKEN
	Pull	Select	N/A
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	

Madison, NC 27025-0700

Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCUMENT WITH YOUR RETURN.

Service Request Number | Serial Number / Description

SR00026225

580

C6531248

Model 700 RIFLE Caliber 17

Customer:

MICHAEL FAUST

(480 STAGE COACH ROAD SE

(480 STAGE COACH ROAD SE / RIO RANCHO, NM 87124 US

580 STAge COACH Rd SE RIO RANGHO NM 87124

900

Date of Request: Date Printed: 08/09/2012

08/09/2012

Destination:

Arms Services 14 Hoefler Ave Ilion, NY 13357 US

Email:

Emzil: mikell40@yzhoo.com

-Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M123 - FORWARD TO PRODUCT SERVICE FOR ENSPECTION

Service Request Section

consumer states that the firearm is going off when they close the bolt.

Parts And Service Details Material

Type

Description

Qr. Needed

Warranty

Disc Amount



T.A. set screws Altered, & very DIRTY. CONNECTOR IS BROKER, Mp hace TPA, clean+ TUST AT 1/2 Normal cost.

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Sub Total:

Grand Total:

.00 .00

Est Sales Tax:

\$.00









