PrintDisplay Page 1 of 2

Remington Arms Co., Inc.
Product Service
Legal Case #:8315

Legal Case #:8315 Case Information RE# **Date Opened** Date Opened(PS) **Date Closed** Incident Date Pre Lit Lit Obsolete 292145 12/10/2012 12/11/2012 12/11/2012 Customer Information Type Business Last Name First Name Street City State Zip Age Contact H 570-637-3003 522 Tomahawk Rd. Incident William Felten 18848 Towanta E william@epix.net Incident Information Claims Repair Est. Medical Treatment **Medical Status** Codes ΡI PD Cause: 4006 Altered Adjustments or Components Unknown S FSR Concern: 1007 Fired on Safe Release SR# 35858 - Reason for Return: Bolt Lock Safety Modification. Service Request Section: Gun was made in 1986 consumer stated that gun fires when you move safety, inspect trigger. df Firearm Information Mfg. Type Model/Ga. SKU Serial Bbl. DOM 700/280 REM B6781364 AG 3/21/1986 Remington CF/BA 25632 **Date Purchased** Where Purchased Accessories Original Owner OSCAR ROBBINS & CO 15213 FRT BASE, BOTTOM HALF RING U CONCERN: FSR Ammunition Information - None Defined Other Products Information - None Defined Settlement Remington/700/CF/BA Cash Reim. Date Cash Date Settlement Release of Claims Release Date Reimbursement Settlement APV APV Per Ilion - Quote to repair @ 1/2 normal cost Repair/Replacement Repair/Replacement Cost Date 12/13/12: Per Ilion - TA set screws altered. Trigger not returning properly. Replace TA, clean & test at 1/2 normal cost - quote. df Examination[Remington/CF/BA]

| Part | Sub-Part | Code | Comment |
|-------------|---------------------------|-----------------------------------|-------------|
| Examination | Examiner | | B.TRAVIS |
| | Exam Date |] | 12/11/2012 |
| | Product Type | | RF |
| | Action Type | | A |
| | Assigned To | | J.BALIO |
| Cause | 4006 | Altered Adjustments or Components | |
| Barrel | Description | | 22" 280 REM |
| | Date Code | | AG |
| | Bore Plugged | False | |
| | Bulged | False | |
| | Fired | False | |
| | Fired while Obstructed | | |

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8315&Type=Case

12/27/2012

| | Muzzle/Crown Condition | Slightly Worn; Functioning | |
|-----------------------------|---------------------------|-----------------------------------|--|
| Bolt | Firing Pin | Slightly Worn; Functioning | |
| | Shroud | Slightly Worn; Functioning | |
| | Face | Slightly Worn; Functioning |] |
| | Handle | Slightly Worn; Functioning | |
| Extractor | Stop | Slightly Worn; Functioning | |
| | Condition | Slightly Worn; Functioning | |
| | Cut Condition | Slightly Worn; Functioning | |
| | Ext/Eject Test | False | |
| | Block Condition | Select | |
| Locking | Lug Condition | Slightly Worn; Functioning | |
| l | Notch Condition | Select | |
| | Exterior Condition | Slightly Worn; Not Functioning | REC'D WITH STK UNASSM FROM ACTION |
| Overall | Stock Condition | Slightly Worn; Functioning | SCRATCHES,MARS |
| | Fore End Condition | Select |] |
| Receiver | Condition | Slightly Worn; Functioning | |
| 0.00 | Bulged | False | |
| | Description | | STANDARD SAFETY |
| Safety Sear | Function | Like new; Functioning | |
| | Lift | Select | N/A |
| | Notch | Slightly Worn; Functioning | |
| | Tests | Test Fired | False |
| Feeding Test | 16818 | False | |
| | Condition | Slightly Worn; Not Functioning | TRIG NOT RETURNING, SEAR NOT CONTACTING CONNECTOR WILL FOLLOW DOWN |
| Trigger | Pull | Select | N/A |
| | Altered | True | SET SCREWS ALTERED |
| | Sub-Assembly | M/700 Non-Bolt Lock | |
| Non-Remington Components | Description | | FRT BASE,BOTTOM HALF RING |

Service Request

Remington Service

A6-3/86

Madison, NC 27025-0700

Parts and Repairs: P:800-243-9700 F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted, This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE

THIS DOCUMENT WITH YOUR RETURN.

Service Report Number SR00035858

Serial Number / Description

B6781364

Model 700 RIFLE Caliber 280

Customer: WILLIAM FELTEN 522 TOMAHAWKRD TOWANTA, PA 18848 US

Date of Request: 11 21 2012 Date Printed: 11/21/2012

Destination: Arms Services 14 Hoefler Ave llion, NY 13357 US

Emzil: william@epix.net Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Resson For Return M240 - BOLT LOCK SAFETY MODIFICATION

Service Request Section

Gun was made in 1986 consumer stated that gun fires when you move safety inspect trigger

Parts And Service Details

Type

Description

Qts Needed

Warranty

Disc Amount

3B6781364

TiA setschews of tened Thig. Not Ret. The TAA, clash
trust AT 1/2 Monand cost

SHIPPED DEC 13 PAID

Sub Total: Est Sales Tax:

.00 .00

Grand Total:

\$.00

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the





