Remington Arms Co., Inc. Product Service Legal Case #:7201

Case Information Date Opened(PS) **Date Closed** RE# **Date Opened** Incident Date Pre Lit Lit Obsolete 1/5/2012 252202 1/4/2012 1/5/2012 Customer Information Type **Business** First Name Last Name Street State Zip Contact Age 6295 Crabtree Rd David Holmes NC 28721 Incident Clyde E holmesplbg@yahoo.com Incident Information Claims Codes Repair Est. Medical Treatment Medical Status PΙ PD Cause: 4006 Altered Adjustments or Components Unknown Concern:1007 Fired on Safe Release S Fired on safety release 1/25/12 Per note with rifle, gun fired when moved safety to fire position.cm Firearm Information SKU DOM Mfg. Model/Ga. Bbl. Type Serial Remington CF/BA 700/270 WIN A6810745 wv 8/1/1979 n/a Where Purchased **Original Owner Date Purchased** Accessories U CONCERN:FSR Ammunition Information - None Defined Other Products Information - None Defined Settlement Remington/700/CF/BA Cash Reim. Cash Settlement Release of Claims Release Date Reimbursement Settlement Date APV Date APV Per Ilion, replace TPA, clean, test fire at BLSM program price Repair/Replacement Repair/Replacement Cost Date 1/25/2012 1/25/12 Per Ilion, trigger assm dirty and set screws altered. Replace TPA, clean, test fire at BLSM program price.cm Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/5/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	•
Barrel	Description		22" 270 WIN
	Date Code		WV
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7201&Type=Case

1/25/2012

i I	01 1	or in w. P. C.	≒
Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor Locking	Condition	Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	.011
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Tes	t	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY, TRIG HAS MIN RETURN WILL FOLLOW DOWN
	Pull	Select	3#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	

Model Number: 700 a6810745 Date of Purchase: Name: david holmes march 1989 Address (no PO Boxes): 6295 crabtree rd City: clyde State: no Zip: 28721 Fax: 8288279353 (Daytime): 8286279681 E-mail Address: holmespibg@yehoo.com Please describe your problem: gn fired when moved safety to fire position NOTE: Prior to shipping your firearm, contact the Repair Center for services

22 W/8/ W/8/ 3th

WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE MAME ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND

provided and estimated repair time.

F YOUR FIREARM.

your firearm before sending it.
revent further damage in shipping and rably, ship in a

boxes may not be returned.)
I firearm to prevent loss or damage.
UPS or Parcel Post. Remington is not

tamage or loss purchase insurance from your carrier.

Reset

A6810745 Model: 700



RE00252202

T.A. dinty + s'et. s crews + Hered.

Riphoce TPA, clean Trost fine
under BLP Lon & b. + Ship

Remington Grms 6 Inc

HI II DA FIREGRAS Plant i order

Cittention BL Softely Promise Pair best

14 Hoefler Cu

Ilian 114 13157

http://www.remington.com/asp/general repair form.asp

12/9/2011





