Remington Arms Co., Inc.
Product Service
Legal Case #:7308

Legal Case #:7308 Case Information **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete RE# 1/23/2012 1/23/2012 1/20/2012 Х 255326 Customer Information Type Business First Name Last Name Street City State Zip Age Contact Incident Donald Hysell 2284 County Rd 124 Chesapeake OH 45619 E dehysell@yahoo.com Incident Information Repair Est. Medical Treatment Medical Status Claims Codes PΙ PD Cause: 4006 Altered Adjustments or Components Unknown S Fires on safety release Concern: 1007 Fired on Safe Release 2/6/12 Per note on SR, gun fires when moving safety from safe to fire repeatedly. Also fails to fire.cm Firearm Information Mfg. Type Model/Ga. SKU Serial Bbl. DOM ML/BA 700/50 CAL 27572 ML019981 WQ 8/9/1996 Remington **Date Purchased** Where Purchased Accessories **Original Owner** WAL-MART WAREHOUSE #3R U CONCERN:FSR Ammunition Information - None Defined Other Products Information - None Defined Settlement Remington/700/ML/BA Cash Reim. Date Cash Date Release of Claims Settlement Release Date Reimbursement Settlement APV APV Per Ilion, replace TPA, clean, check over at 1/2 normal cost Repair/Replacement Repair/Replacement Cost Date 2/6/12 Per Ilion, trigger assm dirty and set screws altered. Replace TPA, clean, check over at 1/2 normal cost.cm Examination[Remington/ML/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/23/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4006	Altered Adjustments or Components	
Barrel	Description		24" 50 CAL
	Date Code		wo
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	DIRTY,RUSTY
	Shroud	Slightly Worn; Functioning	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7308&Type=Case

2/6/2012

Bolt	Face	Slightly Worn; Functioning	DIRTY.RUSTY
			DIK11,KUS11
	Handle	Slightly Worn; Functioning	
	Stop	Select	
Overall	Exterior Condition	Slightly Worn; Not Functioning	DIRTY,RUSTY
	Stock Condition	Slightly Worn; Functioning	DIRTY
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	Select	N/A
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	10015	False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG NOT RETURNING
	Pull	Select	2.5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	

Service Request



Madison, NC 27025-0700

Parts and Repairs: P:800-243-9700/F:336-548-7801 www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCI YOUR RETURN.

Service Request Number / Description SR00009521

ML019981

Customer: DONALD HYSELL 2284 COUNTY RD 124 CHESAPEAKE, OH 45619 US

Email: DEHYSELL@YAHOO.COM

Date of Request01 12 2012 Printed01/12/2012

Destination: Arms Services 14 Hoefler Ave Ilion, NY 13357 US

Email:

w @ 8/9

Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be rep returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M110 - FAILS TO FIRE

M295 - EVALUATE AND REPAIR

Service Request Section

GUN FIRES WHEN MOVEING SAFETY FROM SAFE TO FIRE

TY REPEATLY

ALSO, FAILS TO FIRE. CUSTOMER HAS TO MOVE SAFE

Parts And Service Details

Material

Description Type

Qty Needed

Warranty

Price Disc Amount

Model:

ı

T.A. dinty = set screws oftened.

Highar TPA, cle AN+ cle chour

AT 1/2 NORMA | COST

Sub Total: Est Sales Tax:

.00 .00

Grand Total:

\$.00