

Remington Arms Co., Inc.
Product Service
Legal Case #:7884

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
279273	8/20/2012	8/22/2012	8/22/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Bill	Jacobs	150 South Elm St	Denver	CO	80246		E Bill@thejacobs.org

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038	Could Not Duplicate Concern		Unknown
S	Fired when lifting bolt	Concern:1020 Fired on Bolt Opening		
C				

9/6/12 Per note on SR, gun fired while lifting bolt.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	6486127	EU	10/1/1971
Date Purchased	Where Purchased	Accessories	Original Owner			
	SOUTHERN GUN DIST MIAMI FLA		U			

CONCERN: FBO

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Replace TPA, clean, test at BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	66.40	9/6/2012				

9/6/12 Per Ilion, could not duplicate concern. Trigger assm very dirty and rusty. Replace TPA, clean, test at BLSM program price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		8/22/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
	Description		22" 3006 SPRG

<http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7884&Type=Case>

9/6/2012

Barrel	Date Code		EU
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.011
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	VERY DIRTY,RUSTY
	Pull	---Select---	4.5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	

Service Request

Remington Service

PO Box 700

Madison, NC 27025-0700



ATTN: SMP

Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. PLEASE RETAIN THIS COPY FOR YOUR RECORDS.

22"
EU 10/7i
45#
2011

Service Request Number SR00016176	Serial Number / Description 6486127 Model 700 RIFLE	<u>7884</u>	Date of Request: 06/27/2012 Date Printed: 08/10/2012
Customer: BILL JACOBS 150 SOUTH ELM ST DENVER, CO 80246 US		Destination: Arms Services 14 Hoefler Ave Ilion, NY 13357 US	
Email: BILL@THEJACOBS.ORG		Email:	
Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.			
Reason For Return M240 - BOLT LOCK SAFETY MODIFICATION			
Service Request Section GUN FIRED WHILE LIFTING BOLT SMP			
Parts And Service Details			
Material	Type	Description	Qty Needed Warranty Price Disc Amount
<div style="display: flex; justify-content: space-between;"> <div> <p>Serial Number: 6486127</p> <p>Model: 700</p> <p>RE00279273</p> </div> <div> <p>RECEIVED</p> <p>AUG 27 2012</p> <p>BY:</p> <p>could not dup. concern T. A. very dirty & rusty. replace TPA, clean test and BLP Run. F.W. +</p> </div> </div>			
THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the			
Sub Total:			.00
Est Sales Tax:			.00
Grand Total:			\$.00







