

Remington Arms Co., Inc.
Product Service
Legal Case #:7545

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
263222	3/28/2012	3/30/2012	3/30/2012				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Bill	McCue	302 South Valley Ave	Olyphant	PA	18447		

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	Fired when moving to safe	Concern:1011 Improper Safety Design		
C				

4/18/12 Per note on SR, gun went off while moving to safe.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	A6822081	DV	9/13/1980
Date Purchased	Where Purchased	Accessories	Original Owner			
	SLOANS RIDGEFIELD CT	TWO PIECE BASE,MUZZLE BRAKE	U			

CONCERN: FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test fire at BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	70.02	4/24/2012				

4/24/12 Per Ilion, trigger and trigger pin rusted causing the trigger to bind. Replace TPA, clean, test fire at BLSM program price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		3/30/2012
	Product Type		RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4015	Improper Maintenance	
Barrel	Description		22" 3006 SPRG
	Date Code		DV
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	

Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	SLUGGISH
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		M/700 BOLT LOCK SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
Sear	Lift	---Select---	.010
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	TRIG AND PIN RUSTED TRIG BINDS WILL FOLLOW DOWN
	Pull	---Select---	8.5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE,MUZZLE BRAKE

Service Request

Remington Service

PO Box 700

Madison, NC 27025-0700



Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. **ENCLOSE THIS DOCUMENT WITH YOUR RETURN.**

7545

22"
DVG/76
8.5#
010

Service Request Number SR00015465
Serial Number / Description A6822081
smp

Date of Request: 03/19/2012
Date Printed: 03/19/2012

Customer:
BILL MCCUE
302 SOUTH VALLEY AVE
OLYPHANT, PA 18447 US

Destination:
Arms Services
14 Hoefler Ave
Ilion, NY 13357 US

Email:

Email:

Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M240 - BOLT LOCK SAFETY MODIFICATION

Service Request Section

smp = gun went off while moving to safe

Parts And Service Details

Material	Type	Description	Qty Needed	Warranty	Price	Disc	Amount
----------	------	-------------	------------	----------	-------	------	--------

A6822081

Model: 700



RE00263222

RECEIVED
APR 09 2012

TRIG + TRIP: p+n. rusted CAUSING
THE TRIG TO BIND. Replace TPA,
clean + Test fire under 13P
for \$ 20.00 + ship

Quote

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the item(s) being sent based on the conversation with our representative.

Sub Total: .00
Est Sales Tax: .00
Grand Total: \$.00





