## Remington Arms Co., Inc. Product Service Legal Case #:7613

Case Information RE# Date Opened(PS) **Date Closed Incident Date** Obsolete **Date Opened** Pre Lit Lit 4/24/2012 4/25/2012 4/25/2012 265279 Customer Information First Name Street State Zip Age Contact **Business** Last Name City Type Reporter Michael D Fix Gunshop Michael D Fix G 334 Mt. Penn Rd Reading PA 19607 W 610-775-2067 Incident Information Repair Est. Medical Treatment Claims Codes Medical Status PΓ Cause:4038 Could Not Duplicate Concern PD Unknown Concern: 1007 Fired on Safe Release S Fired on safety release C 5/10/12 Per note with rifle, customer stated that the rifle fired when the safety was removed, without pulling the trigger.cm Firearm Information SKU Bbi. DOM Model/Ga. Serial Туре Mfg. CF/BA 700/243 WIN 20000 B6268261 EA 10/23/1980 Remington Date Purchased Where Purchased Accessories Original Owner JERRYS SPORT CNTR MONTDALE PA SCOPE BASE U CONCERN: FSR Ammunition Information - None Defined Other Products Information - None Defined Settlement Remington/700/CF/BA Cash Reim. Date Cash Date Settlement Release of Claims Release Date Reimbursement Settlement APV APV Replace TPA, clean, test at BLSM program price Repair/Replacement Repair/Replacement Cost Date

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		4/25/2012
	Product Type	]	RF
	Action Type		A
	Assigned To		T.NAGLE
Cause	4038	Could Not Duplicate Concern	
ВагтеІ	Description		22" 243 WIN
	Date Code		EA
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	

5/10/2012

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=7613&Type=Case

62.90

5/10/12 Per Ilion, could not duplicate concern. Replace TPA, clean, test at BLSM program price.cm

5/10/2012

			<del></del>
Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Wom; Functioning	<u> </u>
	Handle	Slightly Worn; Functioning	
Extractor	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
Locking	Ext/Eject Test	False	
	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
Sear	Sub-Assembly	Non-ISS	
	Lift	Select	.008
	Notch	Slightly Worn; Functioning	
	T	Test Fired	False
Feeding Test	Tests	False	
	Condition	Slightly Worn; Functioning	
Trigger	Pull	Select	4.5#
	Altered	False	
	Sub-Assembly	Other Remington	
Non-Remington Components	Description		SCOPE BASE

7613.

## Michael D. Fix Gunshop, Inc.

Guns, Gunsmithing, Shooters Supplies

F.F.L. 8-23-011-01-8H-21481 Tel. (610) 775-2067 Remington.
Warranty Service

334 Mt. Penn Road Reading, Pennsylvania 19607

April 16, 2012

Remington Arms Company 14 Hoefler Avenue Ilion, New York 13357

Our Account No. R3147003

Gentlemen:

Enclosed for your factory safety modification t is one (1) Remington Mod. 700, cal. 243 Win., Ser. No. B6268261 rifle. The customer stated that the rifle fired when the safety was removed, without pulling the trigger.

Thank you for your continuing service and cooperation. We look forward to hearing from you at your earliest convenience.

Sincerely,

Michael D. Fix

APR 2 6 2012

BY:

could protdey. concern Rephrie TOA, clean+ Test under BCH ton \$ 20. t

Cicote

MDF/mlf

Enclosure

B6268261

Model: 700

RE00265279





