

Remington Arms Co., Inc.  
Product Service  
Legal Case #:7853

## Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
278735	8/16/2012	8/20/2012	8/20/2012				

## Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Robert	Simon	108 Fontainebleau Dr	Mandeville	LA	70471		H 985-951-1010 E rsimon210@gmail.com

## Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	Cause:4038 Has discharged while loading and unloading	Could Not Duplicate Concern Concern: 1008 Fired on Bolt Closing	Unknown	
C				

8/31/12 Per letter with rifle, on 3 occasions the rifle has discharged unexpectedly while loading and unloading a shell. His fingers were not near the trigger.cm

## Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/7MM REM MA	n/a	A6834245	EV	10/1/1979
Date Purchased	Where Purchased	Accessories	Original Owner			
	JERRYS SPT CTR HARTFORD CT		U			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

## Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean, test fire at BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	98.94	8/31/2012				

8/31/12 Per Ilion, could not duplicate concern. Trigger assm dirty, sticky. Replace TPA, clean, test fire at BLSM program price.cm

## Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B. TRAVIS
	Exam Date		8/20/2012
	Product Type		RF
	Action Type		A
	Assigned To		T. NAGLE
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		24" 7MM REM MAG
	Date Code		EV
	Bore Plugged	False	
	Bulged	False	
	Fired	False	

	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	--Select--	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	--Select--	
	Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	--Select--	
	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		M/700 BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	Non-ISS	
	Lift	--Select--	.012"
Sear	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY AND STICKY
	Pull	--Select--	4.5#
	Altered	False	
	Sub-Assembly	M/700 Bolt Lock	

02 August 2012

Remington Arms Company, Inc.  
Attn: Arms Services Division/Repairs  
14 Hoefler Avenue  
Ilion, NY 13357

To Whom It May Concern,

I have enclosed a:  
Remington Model 700 BDL, 7MM MAG  
SN A6834245

The rifle has, on three occasions, discharged unexpectedly while loading/unloading a shell. My fingers were NOT near the trigger.

I understand that Remington offers a Modification that will remove the bolt lock to allow me to load/unload with the Safety ON.

Regards,

Bob,

**Robert Simon**  
**108 Fontainbleau Dr.**  
**Mandeville, LA 70471**  
Phone: 985-951-1010  
Email: [rsimon210@gmail.com](mailto:rsimon210@gmail.com)

RECEIVED  
AUG 22 2012

BY:.....

Serial  
Number:

A6834245

Model: 700



RE00278735

could not duplicate concern.  
T.A. dirty & sticky. Replace TPA,  
clean test fire under BLP Ron  
\$20. + ship

Quote

24"  
EV10/11  
4.5"  
10/12

7/53







