

Remington Arms Co., Inc.
Product Service
Legal Case #:8651

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
301642	2/22/2013	2/25/2013	2/25/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Burdett & Son	Kathy Burdett	Burdett & Son	1055 Texas Ave. So. Ste 104	College Station	TX	77840		W 979-695-2807 F 979-695-8779

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components		Unknown	
S FBC	Concern:1008 Fired on Bolt Closing			
C				

Dealer sent rifle in w/note from Kathy Burdett: Please repair the enclosed rifle. The firing pin does not reset and will fall when the bolt is closed. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/308 WIN	84207	G7151627	LG	2/14/2012 10:44:32 AM
Date Purchased	Where Purchased	Accessories	Original Owner			
	HILL COUNTRY WHOLESALE	CHEAK PIECE BOOT	U			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Repair @ n/c - goodwill						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$27					

2/26/13: Per Ilion - Appears TA has been removed and misassembled when returned. Sear spring is out of position & pull screws altered. Properly reassemble & reset to factory specs, check over & test at n/c - goodwill. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		2/25/2013

Examination	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4006	Altered Adjustments or Components	APPEARS TRIGG ASSM WAS REMOVED FROM ACTION AND NOT PROPERLY REASSEMBLED AND PULL SCREW ALTERED
Barrel	Description		20" 308 WIN HB
	Date Code		LG
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Like new; Functioning	
Bolt	Firing Pin	Like new; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Like new; Functioning	
	Stop	Like new; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Like new; Not Functioning	
	Stock Condition	Like new; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Like new; Functioning	
	Bulged	False	
Safety	Description		XMP SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.012
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding	Tests		

Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	SEAR SPRING OUT OF POSITION
	Pull	---Select---	6.5#
	Altered	True	PULL SCREW ALTERED
	Sub-Assembly	X-Mark Pro	



BURDETT & SON

OUTDOOR ADVENTURE SHOP

1055 Texas Ave. So., Ste. 104
College Station, TX 77840
(979) 695-2807
Fax: (979) 695-8779

8651



20"
162/17
6.54
1012

WORK ORDER

DATE: 2-14-13

SHIP TO: Remington Arms
ADDRESS: 14 Hoefler Ave.
CITY, STATE, ZIP: Ilion, NY. 13357
ATTENTION: Arms Service Division

ITEM RETURNED:

Make: Remington 700 , .308, serial number G7151627

WORK REQUESTED:

Please repair the enclosed rifle. The firing pin does not reset and will fall when the bolt is closed.
Thank you.

Kathy Burdett

RECEIVED
FEB 26 2013

BY:

Appens T.A. ~~was~~ has been removed
+ misassembly when returned. Sean
springs out of position + pull
screw altered. Properly reassem.
+ reset to factory specs. check
over + test N/C - Good-will.

#260924

FBC

Serial
Number:

G7151627

Model: 700



RE00301642







