

Remington Arms Co., Inc.
Product Service
Legal Case #:8808

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
308113	4/16/2013	4/17/2013	4/17/2013				X

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Martins Sporting Goods	Don Martin	Martins Sportin	1016 17th Ave.	Monroe	WI	53566		W 608-325-3370

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006	Altered Adjustments or Components		
S	Fires by itself	Concern:1025	Unexplained Discharge - No Mention of Safety Position	Unknown
C				

Dealer included a handwritten note w/gun. Dealer stated " S/N C7500094 has a problem. Sometimes doesn't cock & sometimes it fires when cocked, by itself." df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	HG/BA	XP100/	25387	C7500094	RR	11/18/1997
Date Purchased	Where Purchased	Accessories	Original Owner			
	ELLETT BROTHERS	SCOPE BASE, AFT MKT BBL ASSM	U			

CONCERN:FIRES BY ITSELF

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair @ 1/2 normal cost						

Repair/Replacement Cost	Repair/Replacement Date

4/18/13: Per Ilion - TA has a dried & sticky lube residue causing parts to bind & set screws altered. Can offer to replace TA, clean & check over at 1/2 normal cost - quote. A CSR notated on the repair the customer will mail a check or money order with quote. df

Examination[Remington/HG/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		4/17/2013
	Product Type		RF
	Action Type		A

	Assigned To		S.NICHOLS
Cause	4006	Altered Adjustments or Components	POOR MAINTENENCE
Barrel	Description		18" W/BREAK CAL UNKNOWN
	Date Code		
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.010
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DRIED AND STICKY LUBE RESIDUE,SEAR WORKS SLUGGISH WILL FOLLOW DOWN
	Pull	---Select---	3.5#
	Altered	True	SET SCREWS ALTERED SEALANT MISSING

	Sub-Assembly	M/700 Non-Bolt Lock	
Non-Remington Components	Description		SCOPE BASE, AFT MKT BBL ASSM

Remington Arms 8808

1811
3.54
.010
RR-11/9

The Remington XP100R - S/N C7500094
has a problem. Sometimes doesn't lock &
Sometimes it fires when cocked, by itself.
Please check over & repair as needed.

Thank You,
Don Martin
Martin Sport Shop
1016-17th
Monroe, W.V. 25566
608 325-3370

Serial
Number:

C7500094

Model: XP-100



RE00308113

RECEIVED
APR 18 2013

BY:.....

T.A. has a dried & sticky lube
residue causing parts to
bind & set screws AIT.
can offer to rep TPA, clean &
check over at 1/2 norm. cost.

Q.





