Remington Arms Co., Inc. Product Service Legal Case #:8677

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete 302076 2/26/2013 3/5/2013 3/5/2013 X

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact H 423-538-7581 **Bolling** 189 Taylor Dr Piney Flats TN 37686 Incident Gloria E gloriagoldiegoldie@yahoo.com

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

PD Cause: 4015 Improper Maintenance Unknown Concern: 1008 Fired on Bolt Closing S

Fired when closing bolt

C

3/8/13 Per note with rifle, gun discharges when bolt is closed and safety is off. Also when safety is taken off.cm

Firearm Information

Model/Ga. SKU Serial Bbl. DOM Mfg. Type CF/BA 600/308 WIN n/a 6431883 KU 5/1/1971 Remington

Date Purchased Where Purchased Accessories Original Owner

SIMMONS GN SPECIAL OLATHE KANS

CONCERN: FBC

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/600/CF/BA

Reim. Cash Cash Settlement Release of Claims Release Date Reimbursement Date Date Settlement APV APV

Per Ilion, replace TPA, clean, test at no charge

Repair/Replacement Repair/Replacement Cost Date

> 3/8/2013 43.86

3/8/13 Per Ilion, trigger assm has a dried and sticky lube residue causing parts to work sluggish and bind. Replace TPA, clean, test at no charge under recall,cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner]	B.TRAVIS
	Exam Date]	3/5/2013
	Product Type		RF
	Action Type]	A
	Assigned To]	S.NICHOLS
Cause	4015	Improper	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8677&Type=Case

		Maintenance	
	Description		18.5" 308 WIN
Barrel	Date Code	Ī	KU
	Bore Plugged	Falsc	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	<u>Description</u>		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	.002
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY PARTS BIND AND WORK SLUGGISH. TRIG NOT RETURNING UNDER SEAR WILL FOLLOW DOWN
	Pull	Select	N/A
ļ	Altered	False	SEALANT PRESANT

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8677&Type=Case

3/8/2013

Sub-Assembly Other Remington

Model Number: Serial Number: MOHAWK 600 Date of Purchase: Name: GLORIA BOLLING APPOX.1973 Address (no PO Boxes): 189 TAYLOR DRIVE

City: PINEY FLATS

(Daytime): 423-538-7581

Fax: 423-538-7581

E-mail Address: gloriagoldiegoldie@yahoo.com

Please describe your problem:

State: TN

Gun discharges when bolt is closed and safety is off. Also when safety is taken off.

> 415 characters left

NOTE: Prior to shipping your firearm, contact the Repair Center for services provided and estimated repair time.

WARNING: DO NOT SEND LIVE OR SPENT SHELLS IN YOUR FIREARM OR IN THE SAME BOX WITH THE FIREARM. THIS IS A VIOLATION OF FEDERAL LAW. IF YOU FEEL YOU MUST SEND SPENT SHELLS PLEASE SEND THEM IN A SEPARATE PACKAGE AND INCLUDE NAME, ADDRESS (WITH ZIP CODE), TELEPHONE AND MODEL AND SERIAL NUMBER OF YOUR FIREARM.

: Record the serial number of your firearm before sending it. :: Pack your firearm for safety and to prevent further damage in shipping and handling. Preferably, ship in a firearm box. (Note: Original boxes may not be returned.)

:: Remove all accessories from your firearm to prevent loss or damage. :: Ship your INSURED firearm by either UPS or Parcel Post. Remington is not responsible for damage or loss

during shipment, so you may elect to purchase insurance from your carrier.

Print

Reset





T.A. has A dried + sticky Lube Residue causing parts to work sluggish + BINS. Pup TPA, CGAN + Nest and ruco-Mut N/C

230145