PrintDisplay Page 1 of 3

> Remington Arms Co., Inc. **Product Service** Legal Case #:9068

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed** Incident Date Pre Lit Lit Obsolete 316313 7/25/2013 7/26/2013 7/26/2013

Customer Information

Type Business First Name Last Name Street State Zip Age Contact

Incident

Bybee 9711 County Rd. D Webster WI 54893 Ryan

H 715-566-0556

Incident Information

Claims Codes Repair Est. **Medical Treatment Medical Status**

ΡI

PD Cause: 4015 Improper Maintenance

S FSR Concern: 1007 Fired on Safe Release Unknown

 \mathbf{C}

Per note from customer on Service Request, "My rifle fires when I take it off of safe." jbi

Firearm Information

Mfg. Remington

Type CF/BA

Model/Ga. 600/308 WIN SKU n/a

Serial Bbl. **DOM**

A6208218 EZ 10/10/1975

Date Purchased

Where Purchased **COTTER CHICAGO 11 ILL** Accessories Original Owner

U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/600/CF/BA

Settlement

Release of Claims

Release Date

Reimbursement

Cash

Reim. Cash

Date Date Settlement

Replace trigger assembly, clean, and test fire under bolt lock program for \$20.00 + shipping.

> Repair/Replacement Repair/Replacement Date

Cost

\$25

7/29/13: Customer sent a check for \$20 as payment but had already called in & paid by credit card. I Voided the check & mailed back to customer with a copy of the Invoice from SAP stamped "Paid". df 7/30/13: Per Ilion, trigger assembly is dirty, rusty, and trigger is frozen to side plates. Replace trigger plate assembly, clean and test under BLP for \$20 plus shipping, jbi

Examination[Remington/CF/BA]

http://cps03sp01.remington.com:99/Remington_PSA/PrintDisplay.aspx?ID=9068&Type=... 7/31/2013

PrintDisplay Page 2 of 3

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		7/26/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4015	Improper Maintenance	
Barrel	Description		18.5" 308 WIN
	Date Code		EZ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown		1
	Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Worn; Functioning	HAS BEEN REFINISHED AND CRACKED AT GRIP
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	·
Safety	Description		BOLT LOCK SAFETY
	Function	Slightly Worn; Functioning	
Sear	Lift	Select	N/A
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY/RUSTY. TRIG IS FROZEN TO SIDE PLATES
	Pull	Select	N/A
	Altered	True	SET SCREWS ALTERED

 $http://cps03sp01.remington.com: 99/Remington_PSA/PrintDisplay.aspx?ID=9068\&Type=... \ \ 7/31/2013$

Sub-Assembly Other Remington

www.Reinington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve at a guidaline for our Service Department to address your openific concerns and provide you with accurate and complete service PLLASE RETAIN THIS COPY FOR YOUR RECORDS.

18. 5,3

Service Request Number 06 05:2015 Serial Number / Description Date of Request: SR60054390 A5268218 Date Printed: 95 35 2913 Model Roids Customer: RYAN BYBEE 9711 COUNTY RD D 14 Hoefler Ave Ilion, NY 13357 US WEBSTER, WI 54893 US Email: Emzil: deputy516@sirentel.net "Your respect for service on the item(s) will be evaluated by our repairman to determine if it is covered under our marranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed. Reason For Return M295 - EVALUATE AND REPAIR SAFETY INSP. Service Request Section Accidental discharge Parts And Service Details Qty Needed Wattanio Material Type Description Price Disc Amount MY RIFLE FIRES WHEN 1

715-566-0556

BA6208218



Sub Total: Est Sales Tax:

Grand Total:

T.A. dinty + Rusty. Trig. is Frozen to sideplatus. Mp. TPA. cleANATOST UND - BLP for

0







