PrintDisplay Page 1 of 2

> Remington Arms Co., Inc. Product Service

Legal Case #:8895 Case Information RE# Date Opened Date Opened(PS) **Date Closed** Incident Date Pre Lit Lit Obsolete 310260 5/8/2013 5/9/2013 5/9/2013 Customer Information Type Business First Name Last Name Street City State Zip Age Contact 255 Wilmington/W. Chester Pike Targetmaster Chadds Ford PA 19317 W 610-459-5400 Reporter Tergetmaster Ste 3 Incident Information Claims Codes Repair Est. Medical Treatment Medical Status ы PD Cause: 4015 Improper Maintenance Unknown S Fires sometimes when chambering Concern: 1008 Fired on Bolt Closing C 5/13/13 Per note with rifle, bolt fires sometimes when chambering. Safety lever does not seem right. If possible, replace missing vent rib screw. Customer saw recall info on-line.cm Firearm Information Mfg. Model/Ga. SKU Bbl. DOM Type Serial Remington CF/BA 600/308 WIN n/a 61235 1/1/1966 **Date Purchased** Where Purchased Accessories **Original Owner** SCOPE BASE U CONCERN: FBC Ammunition Information - None Defined Other Products Information - None Defined Settlement Remington/600/CF/BA Cash Reim. Cash Settlement Release of Claims Release Date Reimbursement Settlement Date APV Date APV Per Ilion, replace TPA, clean and test under recall at no charge Repair/Replacement Repair/Replacement Cost Date 44.86 5/13/2013 5/13/13 Per Ilion, trigger assm dirty and rusty. Safety detent ball missing. Replace TPA, clean and test under recall at no charge.cm Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		5/9/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4006	Altered Adjustments or Components	
Barrel	Description		18.5" 308 WIN
	Date Code		BN
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8895&Type=Case

5/13/2013

l	1.0	-	1
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Wom; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning]
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Not Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	.002
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning	SAFETY DETENT BALL MISSING WILL FOLLOW DOWN
	Puli	Select	2.5#
	Altered	True	SET SCREWS ALTERED AND RESEALED
	Sub-Assembly	Other Remington	
Non-Remington Components	Description		SCOPE BASE

INDOOR FIREARM RANGE and GUN SHOP 255 Wilmington/W. Chester Pike, Suite 3 Chadds Ford, PA 19317

(610) 459-5400 FAX (610) 459-3607 www.targetmaster.com

18.5

RH1/66

Remington AHN WARRANTY

REMINSTON ACCOUNT = REDACTED

FIND enclosed RemingTON 600 # 61235

* BOIT FIRES SOME TIMES WHEN CHAMBERING

* SaFety Som lever Does NOT Seem RISHIT.

* IF Possible Please replace MISSIMS VENT RIB SCREW

* Customer Saw Recall INFO ON lINE

Please INSPECT AND Make Sure Safe

ANY QUESTIONS Please Contact Bob Bonnett General Manager Joe Myers Manager

THANKS TargeTMasteR

(Model: 600

T. A. dirly + ionsty. Sahety de Lent ball missing. 14p. TPA, CLEAN+ TOST und. worll at M/c #290145

INS, used scikus







