Remington Arms Co., Inc.
Product Service
Legal Case #:8771

Legal Case #:8771 Case Information Date Opened(PS) Date Closed Obsolete RE# **Date Opened** Incident Date Pre Lit Lit 4/4/2013 306812 4/3/2013 4/4/2013 Х Customer Information Zip Contact Type Business First Name Last Name Street City State Age Eric Ohman 240 Sea Cliff Ave Sea Cliff NY 11579 E ohman.eric@gmail.com Incident Incident Information Repair Medical Medical Claims Codes Treatment Status ΡI PD Cause: 4015 Improper Maintenance Concern: 1025 Unexplained Discharge - No Mention of Safety Position Unknown Fired without pulling the S 4/8/13 Per note on SR, the rifle went off while hunting without pulling the trigger. The owner stated the 1979 recall had not been performed on this rifle.cm Firearm Information Model/Ga. SKU Bbl. DOM Mfg. Type Serial Remington CF/BA 660/243 WIN n/a 103026 BR 1/1/1968 Original Owner Date Purchased Where Purchased Accessories U CONCERN: FIRED WITHOUT PULLING TRIGGER Ammunition Information - None Defined Other Products Information - None Defined Settlement Remington/660/CF/BA Cash Reim. Cash Settlement Release of Claims Release Date Reimbursement Settlement Date APV Date APV Per Ilion, replace TPA, clean and test under recall at no charge Repair/Replacement Repair/Replacement Cost Date 43.86 4/8/2013 4/8/13 Per Ilion, trigger assm dirty and sticky. Parts work sluggish. Replace TPA, clean and test under recall at no charge.cm Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		4/4/2013
	Product Type	]	RF
	Action Type	] ·	A
	Assigned To		S.NICHOLS
Cause	4015	Improper Maintenance	
Barrel	Description		20" 243 WIN
	Date Code		BR
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8771&Type=Case

4/8/2013

	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
Bolt  Extractor  Locking  Overall	Shroud	Slightly Worn; Functioning	1
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	=
	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
Receiver	Fore End Condition	Select	
	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	.004
	Notch	Slightly Worn; Functioning	]
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY PARTS WORK SLUGGISH WILL FOLLOW DOWN
	Pull	Select	5#
	Altered	False	SEALANT MISSING ON PULL SCREW
	Sub-Assembly	Other Remington	

## Service Request

Remington Service



Madison, NC 27025-0700 www.Remington.com

Parts and Repairs: P:800-243-9700 F:336-548-7801

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. PLEASE RETAIN THIS COPY FOR YOUR RECORDS

Serial Number / Description Date of Request: 03-28 2013 SR00049243 103026 Date Printed: 03/28/2013 Model Destination: ERIC OHMAN Arms Services 240 SEA CLIFFAVE SEA CLIFF, NY 11579 US 14 Hoefler Ave Ilion, NY 13357 US Email: ohman.eric@gmail.com -Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed. Model 660 243 cal Reason For Return M240 - BOLT LOCK SAFETY MODIFICATION Service Request Section Consumer states the rife went off while they where hunting without pulling the trigger. States the 1 979 recall has not been performed on this rifle. Parts And Service Details Material Description Price Disc Amount

103026 Model:

THIS IS NOT AN INVOICE. This is a pre-astimate to repair, recondition, or replace the

T.A. Lipty + Sticky PAINSWORK Sluggish. Ilp. TOA, clear Ke ST UND NECALL AT N/C

Sub Total: Est Sales Tax: Grand Total:

BY: ....

4/1/13 10:38 AM

1 of 2







