Remington Arms Co., Inc. **Product Service** Legal Case #:8773

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete

4/4/2013 4/4/2013 306776 4/3/2013

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact H 501-658-6163

1598 Lawson Oaks Dr. Little Rock AR 72210 Incident Keith Creek

E dkceagle@sbcglobal.net

Incident Information

Claims Codes Repair Est. **Medical Treatment Medical Status**

ΡI

PD Cause: 4038 Could Not Duplicate Concern

S FBC Concern: 1008 Fired on Bolt Closing

Unknown

Service Request# 48833 - Reason for Return: M123 Forward to Product Service, M240 Bolt Lock Safety Modification. Service Request Section: Gun went off when closing the bolt. df

Firearm Information

Mfg.

Type

Model/Ga.

SKU

Serial Bbl. DOM

Remington **Date Purchased** CF/BA

700/22-250 REM Accessories

n/a

A6535533 XO 12/1/1977

Where Purchased HENDERSON HOWE BREENVILLE MS **Original Owner**

U

CONCERN: FBC

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement Release of Claims

Release Date

Reimbursement Settlement

Reim. Date

APV

Cash

Cash Date APV

Per Ilion - Quote to repair under BLM

Repair/Replacement Repair/Replacement Cost Date

\$29

4/5/13: Per Ilion - Could not duplicate concern, replace TA, clean & test under BLM - quote. df 4/8/13: A CSR contacted customer about the quote on 4/4/13. Customer will mail check with quote. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		4/4/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS

Cause	4038	Could Not Duplicate Concern	
Barrel	Description		24" 22-250 REM
	Date Code		xo
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	BEDDED
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	.008
	Notch	Slightly Worn; Functioning	
	T	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY
	Pull	Select	6.5#
	Altered	False	FACTORY SEALANT PRESANT
	Sub-Assembly	M/700 Bolt Lock	

Service Request

Remington Service PO Box 700



Parts and Repairs: P:800-243-9700 F:336-548-7801

Madison, NC 27025-0700 www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve at a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service.PLEASE RETAIN THIS COPY FOR YOUR RECORDS.

Service Request Number SR00048833

Serial Number / Description

A6535533

Customer: KEITH CREEK

LITTLE ROCK, AR 72210 US

1598 LAWSON OAKS DR.

Dectination:

Date of Request:

03/25/2013

Date Printed: 03 25 2013

Arms Services 14 Hoefler Ave

Ilion, NY 13357 US

Email:

Email: dkceagle@sbcglobal.net Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

HONE

501-658-6163

the state of the s

Resion For Return
M123 - FORWARD TO PRODUCT SERVICE FOR INSPECTION

M240 - BOLT LOCK SAFETY MODIFICATION

Service Request Section

Gun went off, when dosing the bolt.

Parts And Service Details
Material Type

Description

Warranty

Price Disc Amount

¹2 BA6535533

Model:



could not dup concern.

Rep TPA, clean+ Testund

BCP Conzo+

 φ

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Sub Total: Est Sales Tax:

.00 .00

Grand Total:

\$.00







