

Remington Arms Co., Inc.
Product Service
Legal Case #:8472

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
296173	1/11/2013	1/14/2013	1/14/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Oden	Davis	601 W. Calpaldo Rd.	Frontenac	KS	66763		H 620-249-0925 E oden3@cox.net

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006 Altered Adjustments or Components		Unknown	
S FSR	Concern:1007 Fired on Safe Release			
C				

SR# 38691 - Service Request Section: gun fired when safety was pushed off. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	6552979	CW	4/1/1972
Date Purchased	Where Purchased	Accessories	Original Owner			
	WHITNEY CO DENVER COLO	TWO PIECE BASE	U			

CONCERN:FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair under BLM						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$29					

1/15/13: Per Ilion - TA dirty & set screws altered. Trigger not returning properly. Replace TA, clean & test under BLM - quote. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/14/2013
	Product Type		RF
	Action Type		A
	Assigned To		J.BALIO
Cause	4006	Altered Adjustments or Components	
Barrel	Description		22" 3006 SPRG
	Date Code		CW
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.007
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY. TRIG NOT RETURNING PROPERLY WILL FOLLOW DOWN
	Pull	---Select---	4#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

PO Box 700
Madison, NC 27025-0700

1 0000 10000 10000 10000 10000 10000 10000 10000 10000 10000

Parts and Repair: P:800-243-9700 F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCUMENT WITH YOUR RETURN.

22"
C W 4/72
4#
.007

Service Request Number SR00038691	Serial Number / Description 6552979 Model 700006	Date of Request: 12/14/2012 Date Printed: 12/14/2012
Customer: ODEN DAVIS 601 WEST CAPALDO RD FRONTENAC, KS 66763 US Email: oden3@cox.net	Destination: Arms Services 14 Hoedler Ave Ilion, NY 13357 US	
Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.		
Reason For Return M240 - BOLT LOCK SAFETY MODIFICATION		
See Request Section gun fired when safety was pushed off.		
Parts And Service Details		
Material	Type	Description
	Qty Needed	Warranty
		Price Disc Amount
Serial Number: 6552979 Model: 700  RE00296173		
RECEIVED JAN 15 2013 BY: _____		
T.A. dirty + set screws tightened Trigger not set properly. TPA, clean + rest until BCP Rom 20. +		
THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the		
Sub Total: .00 Est Sales Tax: .00 Grand Total: \$.00		







