

Remington Arms Co., Inc.
Product Service
Legal Case #:9689

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
331034	12/16/2013	12/17/2013	12/17/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Davis Sport Shop	---	Davis Sport Sho	120 Route 17	Sloatsburg	NY	10974		W 845-753-2198 E davissport@att.net

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD				
S	FSR while dry firing	Cause:4006 Altered Adjustments or Components Concern:1007 Fired on Safe Release	Unknown	
C				

SR00069451 - Dealer stated in a note "Customer is claiming when the gun is switched from safe to fire it dry fires."
df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	6447371 PU	6/1/1971

Date Purchased	Where Purchased	Accessories	Original Owner
	CHAS GREENBLT HEMPSTEAD L I	TWO PIECE BASE	U

CONCERN: FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair under BLM						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$29					

12/19/13: Per Ilion - TA dirty & sticky & set screws altered. Replace TA, check over & test under BLM - Quote. df
1/10/14: No response to quote. I called store & spoke w/Teresa & she apprvd & paid by CC#. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/17/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4006	Altered Adjustments or Components	POOR MAINTENENCE
Barrel	Description		22" 3006 SPRG
	Date Code		PU
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	REM SYN STK
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	

Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.010
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY,TRIG NOT RETURNING WILL FOLLOW DOWN
	Pull	---Select---	3#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

Quotation

Estimating Report

Parts and Repairs: P:/F:

Page: 1

All PRICES QUOTED ARE IN EXCHANGE FOR REPLACED PARTS.

THIS IS NOT AN INVOICE. THIS IS AN ESTIMATE TO REPAIR, RECONDITION, OR REPLACE THE ITEM(S) DESCRIBED BELOW. IF THIS IS SATISFACTORY, PLEASE APPROVE BY SIGNING BELOW AND RETURNING TO THE ABOVE ADDRESS. REPAIR TO TAKE APPROXIMATELY (6) WEEKS AFTER RECEIPT OF APPROVAL. IF WE DO NOT RECEIVE YOUR APPROVAL IN 21 DAYS, WE WILL RETURN THE ITEM(S) AS RECEIVED, POSTAGE DUE.

Remington disclaims all warranties concerning legality of a firearm's configuration under applicable state, county & local laws or regulations. Consumers are advised to check their local laws to determine whether certain firearm features are lawful.

Customer:

DAVIS SPORTS SHOP
120 ROUTE 17
SLOATSBURG, NY 10974 US

Item Return To:

DAVIS SPORTS SHOP
120 ROUTE 17
SLOATSBURG, NY 10974 US

Please Circle One:

VISA MC DISCOVER Card No. _____ Exp. Date _____
Open Account: R _____ PO Number: _____

Approval Signature: _____ Date: _____
Daytime Phone: (____) _____ Time to Call: _____

☐ If you desire any change, please use the reverse side for your comments and mark this box.

Repair Number	Serial Number / Description	Date Received:	12/16/2013
RE00331034	6447371	Estimate Date:	12/17/2013
	Model 700 RIFLE 30-06 sprg	Date Printed:	1/10/2014

Reported	Problems Found
R014 - FORWARD TO PRODUCT SERVICE FOR INSPECTION	R014 - FORWARD TO PRODUCT SERVICE FOR INSPECTION U008 - BOLT LOCK SAFETY MODIFICATION

Technician Comments
trigger assembly dirty, sticky and set screws altered. replace trigger assembly, check over and test fire under bolt lock program for \$20.00 + shipping

ESTIMATE (note: C.O.D./Shipping and Handling Charges are NOT Included in this Quote.)							
Material	Type	Description	Qty Needed	Warranty	Qty From Inv	Price	Disc Amount
F305570B	Part	X-MARK PRO 700 TRIG ASSB RH BLACK (OS)	1	Warranty	1	.00	0 .00
4000114	Service	GR-SHIPPING & HANDLING (GUN REPAIR)	1	Billable	1	17.00	0 17.00
4000116	Service	GR-LABOR	20	Billable	20	1.00	0 20.00
4000119	Service	GR-TEST	1	Warranty	1	.00	0 .00

PAID

1/10/14 df

Sub Total: 37.00
Est Sales Tax: 2.59
Grand Total: \$39.59

9689
DAVIS SPORT SHOP INC.

120 ROUTE 17

SLOATSBURG, NY 10974

(845)753-2198

FFL# 6-13-087-01-6D-02896 EXP: APRIL 2016

RETURN FOR REPAIR

RETURN AUTHORIZATION:

SR00069451

MANUFACTURER:

Remington

MODEL:

700

SERIAL:

6447371

FIREARM IS BEING SENT BACK BECAUSE:

Customer is claiming when
the gun is switched from
Safe to fire it dry fires.

RECEIVED
DEC 19 2013

BY:.....

Serial
Number:

6447371

Model: 700



RE00331034

T.A. dirty + sticky + set
Screws A.H. Rep. T.A., check
over + test and. BCP
Low 20 +

6

22"
Pulley
3#
010







