

Remington Arms Co., Inc.

Product Service

Legal Case #:9078

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
316637/316638	7/30/2013	7/31/2013	7/31/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Luke	Dwyer	119 Hickory Circle	Greentown	PA	18426		H 845-866-0457 E ltdtdi@yahoo.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4038	Could Not Duplicate Concern		
S	FBC	Concern:1008 Fired on Bolt Closing	Unknown	
C				

Per SR00057173 Service Request Section, "I have two Model 700 3006 one of them went off while unloading in the past I understand it may be a trigger problem."

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	6771404	OY	7/1/1974
Date Purchased	Where Purchased	Accessories	Original Owner			
	SIMON ATLAS SNS BELTSVIL MD		U			

CONCERN: WENT OFF WHILE UNLOADING

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	6771805	OY	7/1/1974
Date Purchased	Where Purchased	Accessories	Original Owner			
	SIMON ATLAS SNS BELTSVIL MD		U			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV

Per Ilion, quote
to repair BLM

Repair/Replacement Cost	Repair/Replacement Date
\$27	

8/1/13: I called customer with quotes on the two guns. He ask that I call him later in the day because he did not have his credit card with him. Called customer and he approved both repairs with credit card. jbi

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		7/31/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		22" 3006 SPRG
	Date Code		OY
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.007
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY,RUSTY
	Pull	---Select---	5.5#
	Altered	False	SEALANT PRESANT

	Sub-Assembly	M/700 Bolt Lock
--	--------------	-----------------

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		7/31/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4038	Could Not Duplicate Concern	
Barrel	Description		22" 3006 SPRG
	Date Code		OY
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.006
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	VERY DIRTY,RUSTY
	Pull	---Select---	5#
	Altered	False	SEALANT PRESANT

	Sub-Assembly	M/700 Bolt Lock	
--	--------------	-----------------	--

Madison, NC 27025-0700

www.Remington.com

Repairs: P:800-243-9700 F:336-548-7801

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. **ENCLOSE THIS DOCUMENT WITH YOUR RETURN.**

221
047/7
5.5#
1007

Service Request Number SR00057171
Serial Number / Description 6771805
Model 700006

Date of Request: 07-19-2013
Date Printed: 07-19-2013

Customer:
LUKE DWYER
119 HICKORY CIRCLE
GREENTOWN, PA 18426 US

Destination:
Arms Services
14 Hoefler Ave
Hion, NY 13357 US

Email: liddi@yahoo.com

Email:

-Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return
M240 - BOLT LOCK SAFETY MODIFICATION

Service Request Section

I have two model 700 3006 on of them went off while unloading in the past I understand it may be a trigger problem

Parts And Service Details

Material	Type	Description	Qty Needed	Warranty	Price	Disc	Amount
----------	------	-------------	------------	----------	-------	------	--------

Serial Number: 6771404
Model: 700



RE00316637

RECEIVED
AUG 01 2013

BY:.....

could not dup. concern
T.A. dirty, rusty. Rep. TPA
chanx test und-BLT Rev
20 f

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Sub Total: .00
Est Sales Tax: .00
Grand Total: \$.00

Madison, NC 27025-0700

Parts and Repairs: P:800-243-9700 F:336-548-7301

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. **ENCLOSE THIS DOCUMENT WITH YOUR RETURN.**

22"
047/74
5#

Service Request Number
SR00057173

Serial Number / Description
6771404
Model 700006

Date of Request: 07/19/2013
Date Printed: 07/19/2013

Customer:
LUKE DWYER
119 HICKORY CIRCLE
GREENTOWN, PA 18426 US

Destination:
Arms Services
14 Hoefler Ave
Ilion, NY 13357 US

Email: lldtdi@yahoo.com

Email:

-Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return
M240 - BOLT LOCK SAFETY MODIFICATION

Service Request Section

I have Two model 700 3006 ONE of Them went off while
unloading in the past I understand it may be A TRIGGER problem

Parts And Service Details

Material	Type	Description	Qty Needed	Warranty	Price	Disc	Amount
----------	------	-------------	---------------	----------	-------	------	--------

Serial Number:
6771805

Model: 700



RE00316638

RECEIVED
AUG 01 2013

BY:

could not dup, co owner.
T.A. very dirty & rusty.
Rep TPA, clean + test used.
BLP at 20 +

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Sub Total: .00
Est Sales Tax: .00
Grand Total: \$.00




5.6.07



316637



316037

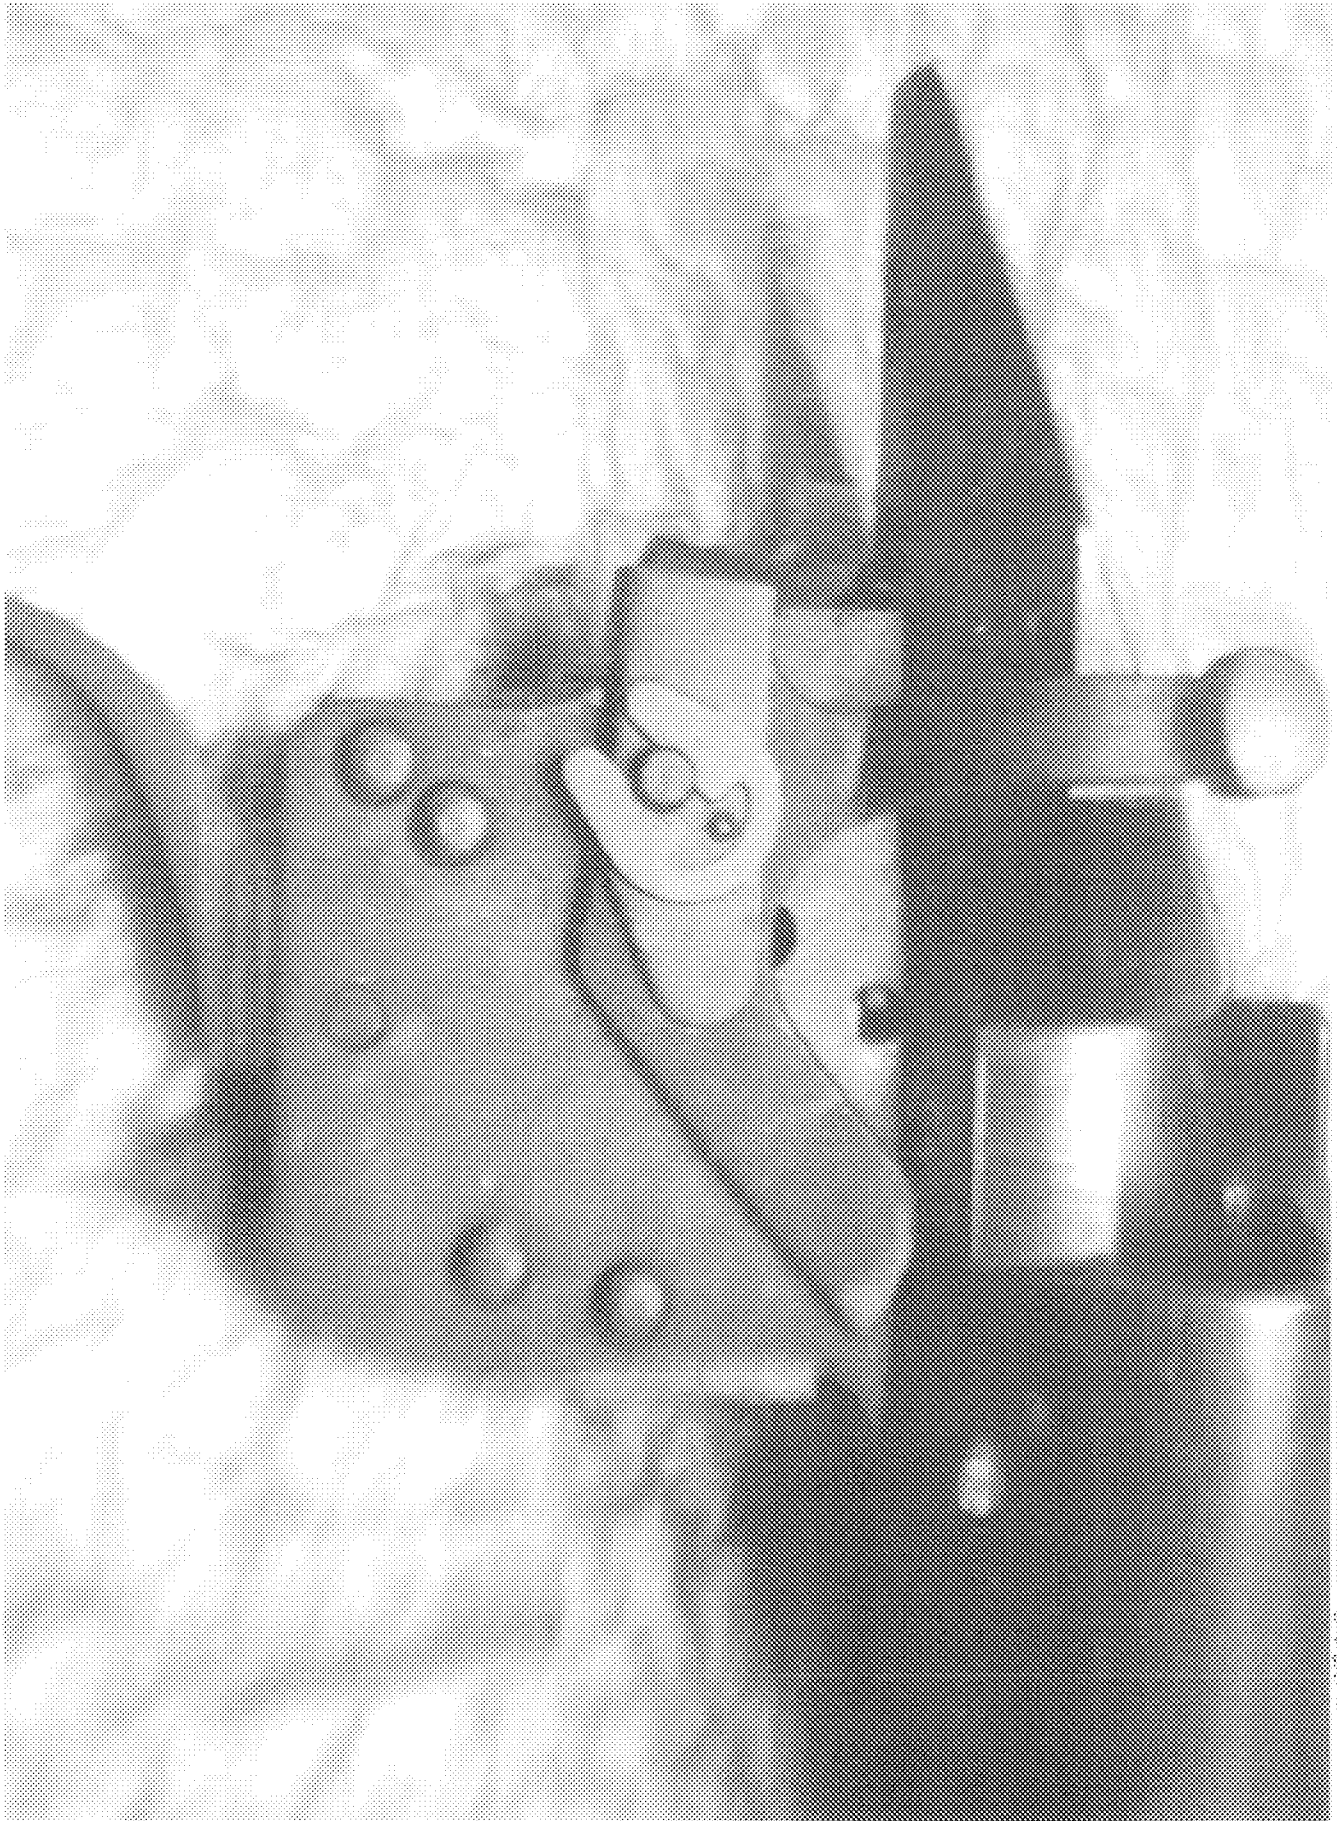


36637



716038


6771805

Model 700

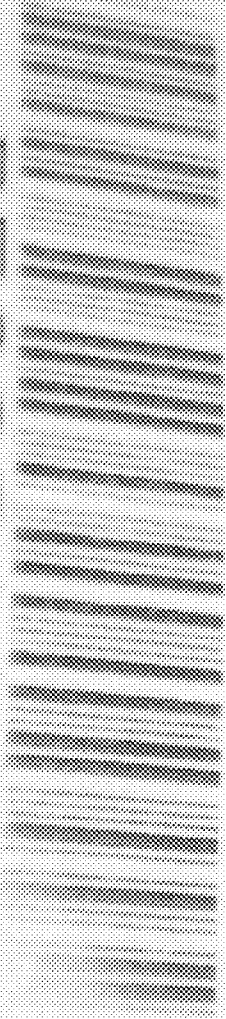


RE0031665

316 63A

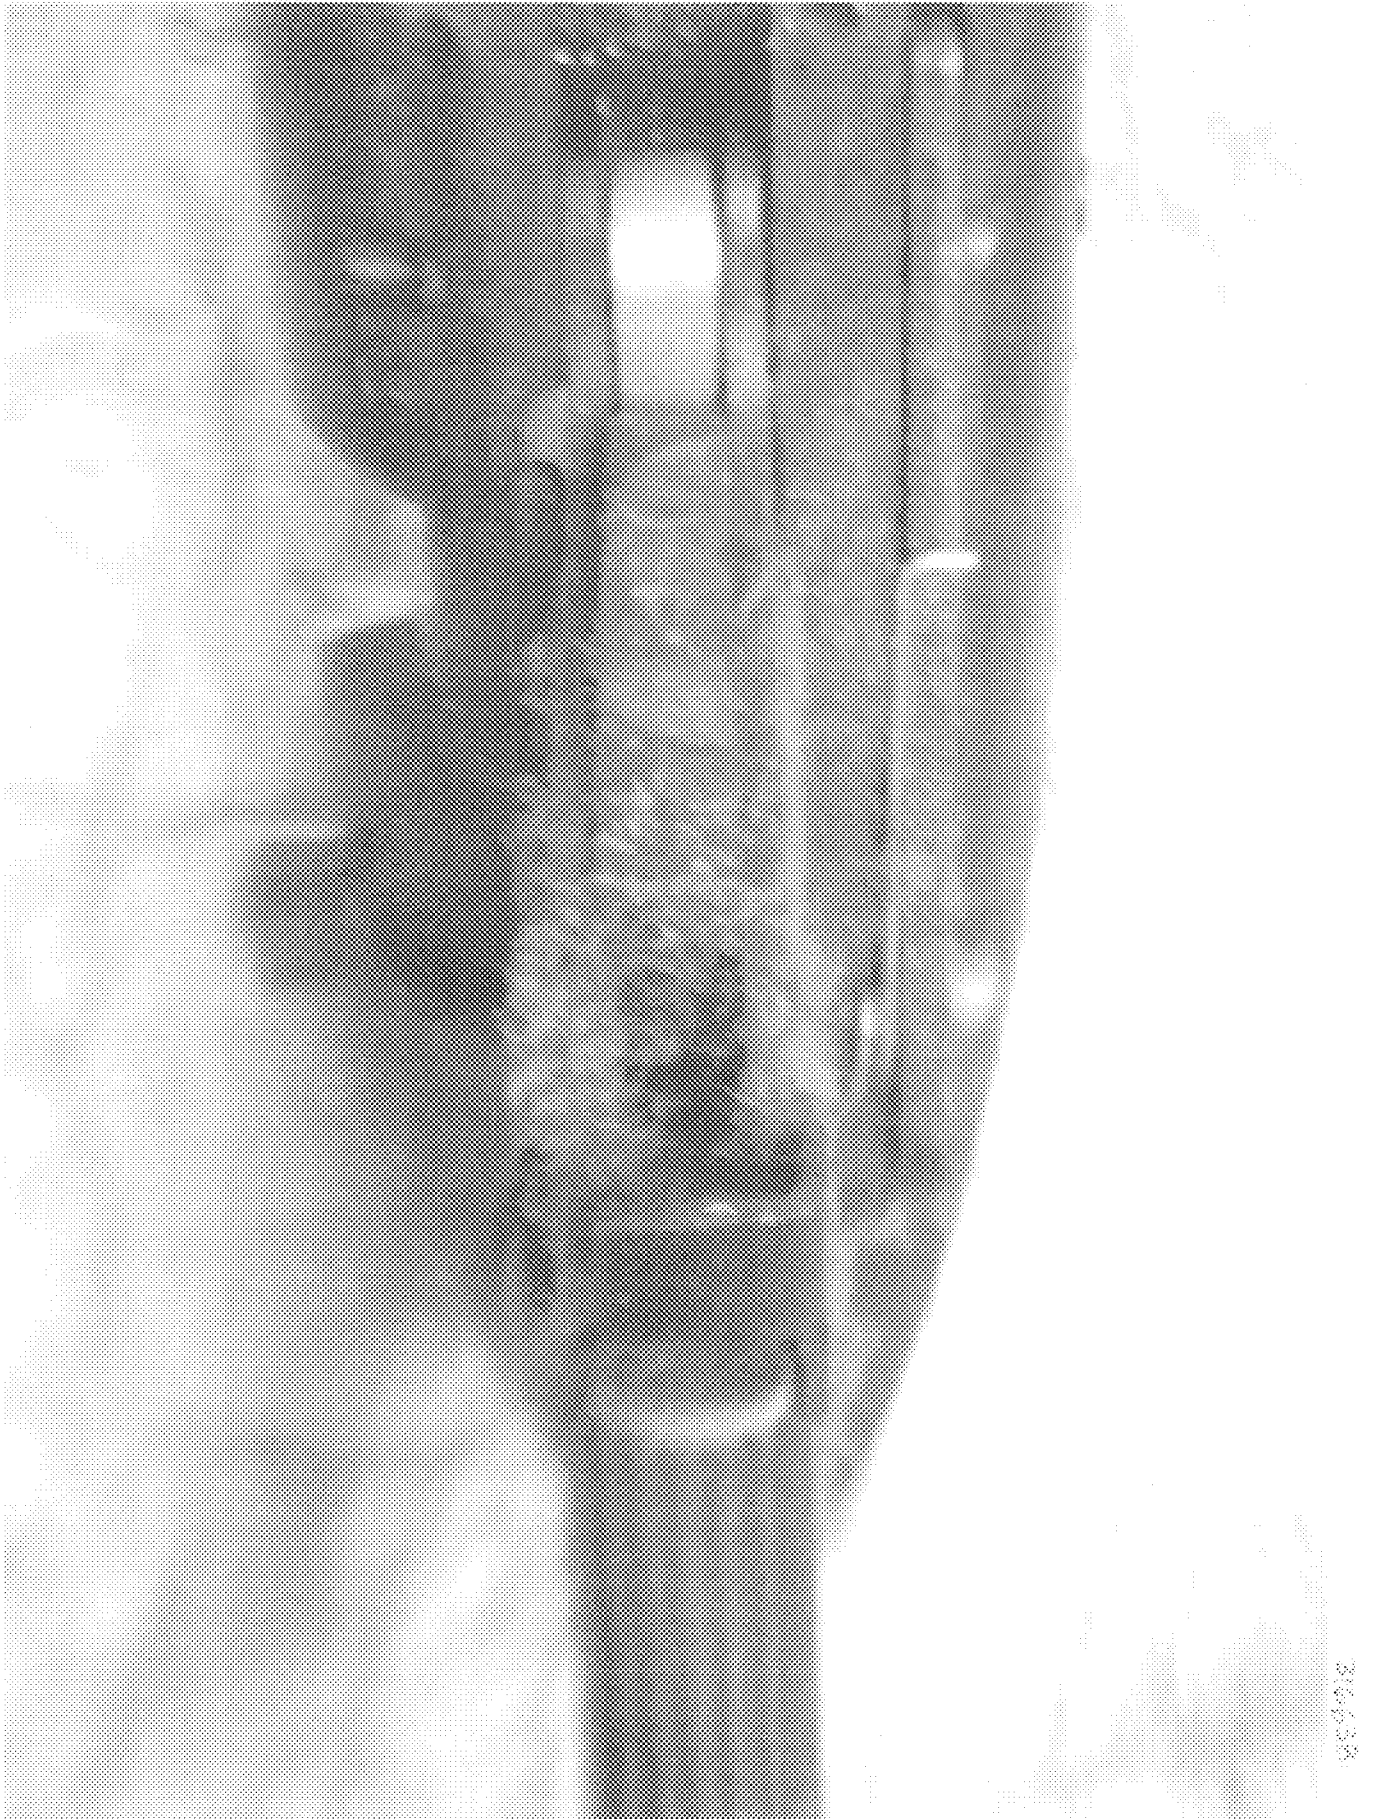

36638

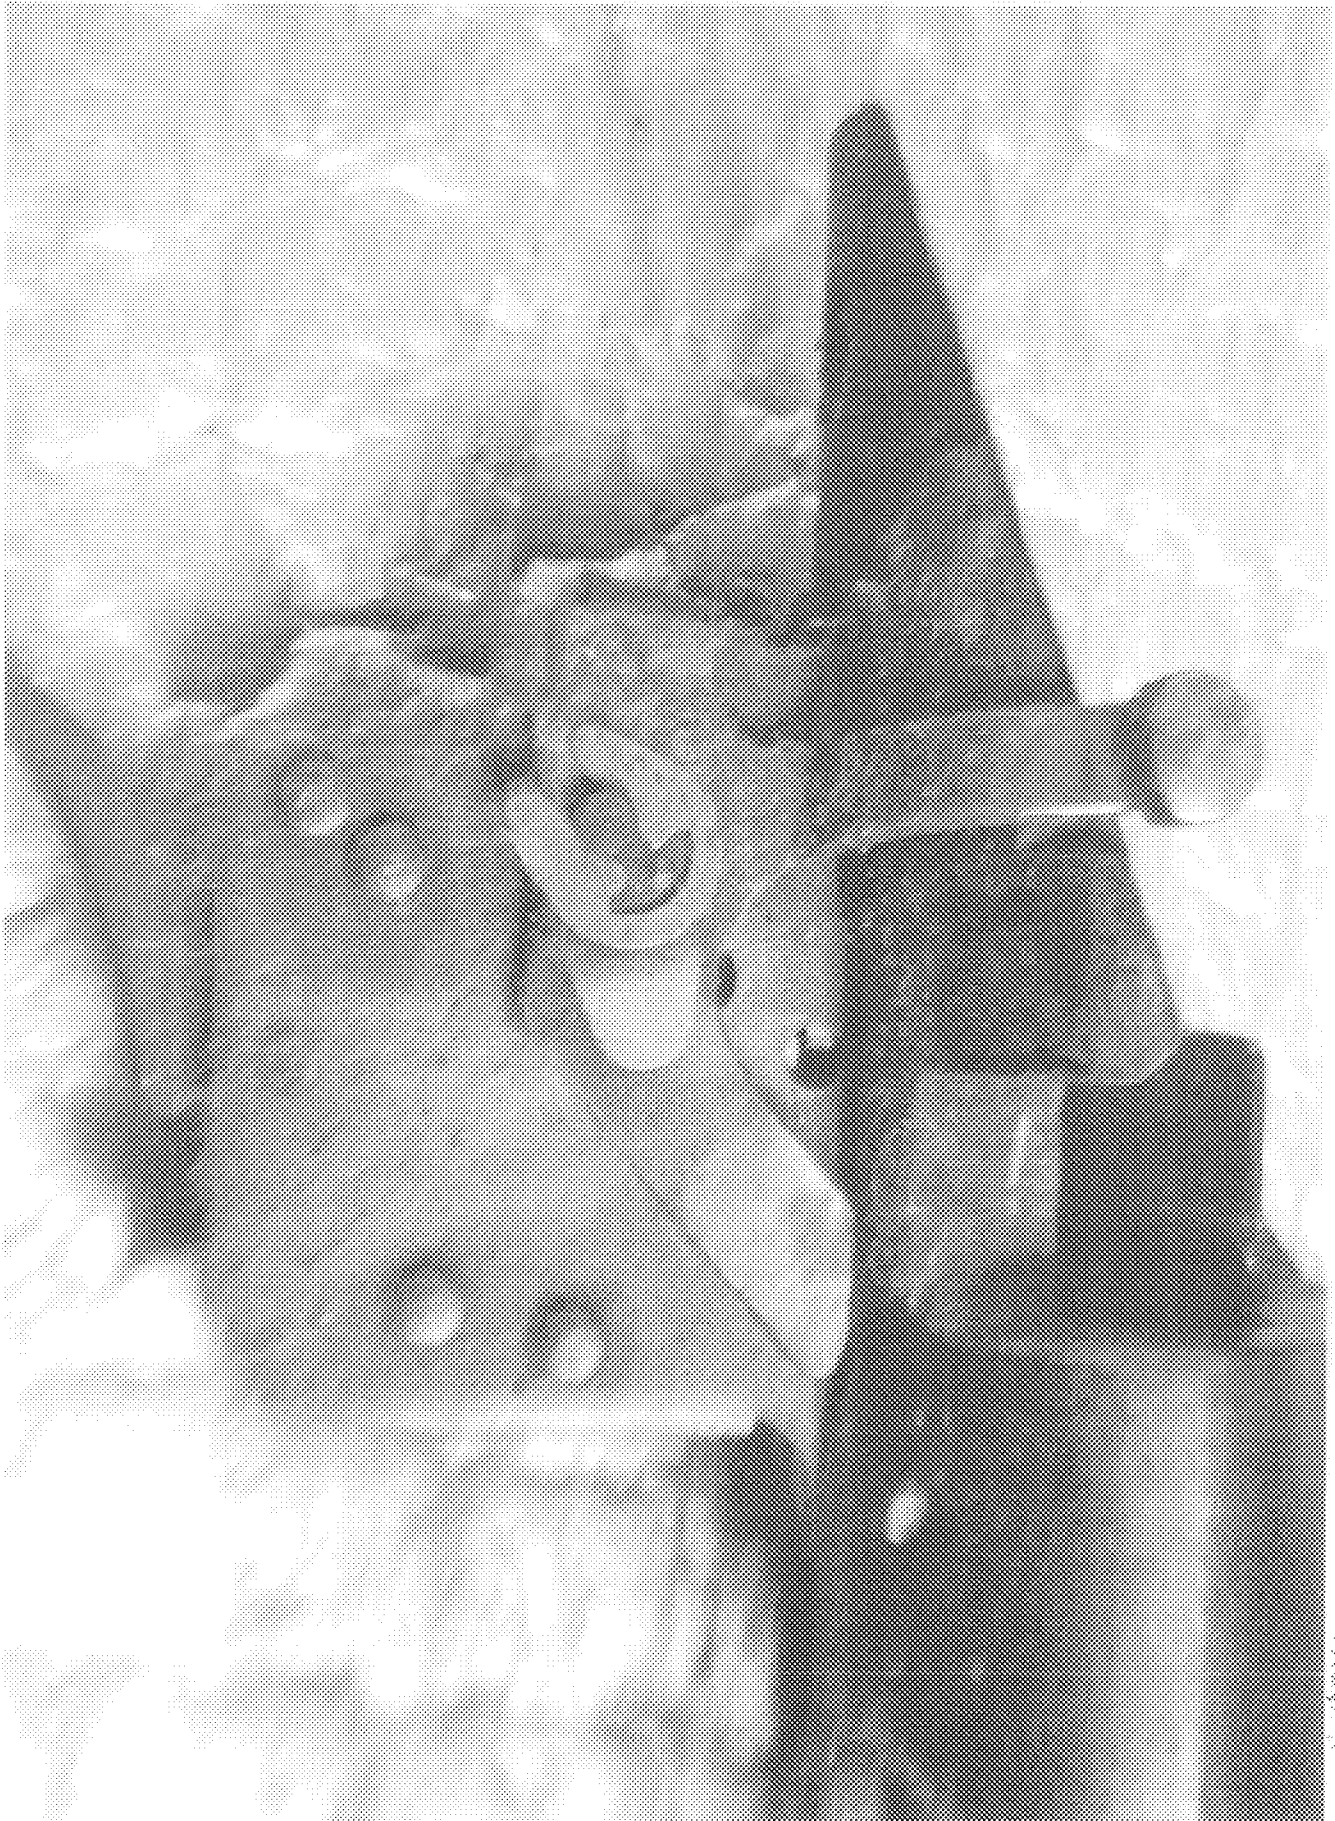

859916