PrintDisplay Page 1 of 3

> Remington Arms Co., Inc. Product Service Legal Case #:8423

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete

294253 1/2/2013 1/3/2013 1/3/2013

**Customer Information** 

Type Business First Name Last Name Street City State Zip Age Contact H 724-266-5863 Fitzgerald 189 Wallrose Heights Rd. Baden PA 15005 Incident George E gef31553@yahoo.com

Incident Information

Repair Medical Medical Claims Codes Est. **Treatment** Status

ΡI

PD Cause:4015 Improper Maintenance

Concern:1025 Unexplained Discharge - No Mention of Gun fired with no

Unknown

U

Safety Position trigger pull

C

SR# 37614 - Service Request Section: Gun went off without pulling trigger. df

Firearm Information

Mfg. Model/Ga. SKU Type Serial Bbl. DOM Remington CF/BA 700/270 WIN n/a 297603 WP 8/1/1967 Date Purchased Where Purchased Accessories **Original Owner** 

CONCERN: WENT OFF WITHOUT PULLING TRIG

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Cash Cash Reim. Settlement Release of Claims Release Date Reimbursement Date Settlement Date APV APV

Per Ilion - Quote to repair under BLM

> Repair/Replacement Repair/Replacement Cost \$29

1/5/13: Per Ilion - TA has a dried lube residue causing sear to bind to side plates. Replace TA, clean & test under BLM quote. df

Examination[Remington/CF/BA]

Part Sub-Part Code Comment Examiner B.TRAVIS Exam Date 1/3/2013 Product Type Examination RF Action Type Α Assigned To J/BALIO

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8423&Type=Case

1/11/2013

PrintDisplay Page 2 of 3

Cause	4015	Improper Maintenance	
ВагтеІ	Description		22" 270 WIN
	Date Code		WP
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	SLUGGISH
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	MARS,SCRATCHES
	Fore End Condition		
Receiver	Condition	Slightly Worn; Functioning	
		False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	N/A
	Notch	Slightly Worn; Functioning	
	J	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DRIED LUBE RESIDUE SEAR BINDS TO SIDEPLATES AND TRIG BINDING WILL FOLLOW DOWN
	Pull	Select	2.5#
	Altered	False	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8423&Type=Case

Sub-Assembly M/700 Bolt Lock

Slideshow

Return to Yahoo! Mail

Service Request

Remington Service PO Box 700



22" W P8/6

Parts and Repairs: P:800-243-9700 F:336-548-7801

Madison, NC 27025-0700 www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service PLEASE RETAIN THIS COPY FOR YOUR RECORDS.

8423 Service Request Number Serial Number / Description Date of Request: 12-05/2012 SR00037614 297603 Date Printed: 12 05/2012 Customer: GEORGE FITZGERALD Destination: Arms Services 189 WALLROSE HEIGHTS RD 14 Hoefler Ave BADEN, PA 15005 US Ilion, NY 13357 US Email: GEF31553@YAHOO.COM Email: Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed. M123 - FORWARD TO PRODUCT SERVICE FOR INSPECTION NO40 - BOLT LOCK SAFETY MODIFICATION Service Request Section
GUN WENT OFF WITHOUT PULLING TRIGGER. Parts And Service Details

297603 Model: 700 RE00294253

THIS IS NOT AN ENVOICE. This is a pre-estimate to repair, recondition, or replace the

T.A. has a doiled lube residue causing sear to bound to sidophies. Nor. TPA CUBALTESTURD BUP for 20,+ Sub Total: 00

Grand Total:

19.5°

I JAN 0 5 2013

BY:....

1 of 3

l of 1

12/5/2012 4:10 PM







