Page 1 of 3

Remington Arms Co., Inc.

Product Service Legal Case #:9302

Case Information

Pre Lit Lit Obsolete RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** 323841 10/14/2013 10/15/2013 10/15/2013

Customer Information

First Last Street City State Zip Age Contact Type Business Name Name

H 254-217-3788

10008 Orion Incident Andrew Temple TX 76502 Ε Fryman Dr andrew.t.fryman.ctr@mail.mil

Incident Information

Claims Repair Est. Medical Treatment Medical Status Codes

ы

PD Altered Adjustments or Components Cause:4006 S

Unknown FBC Concern: 1008 Fired on Bolt Closing

Per SR00062655 Service Request Section, when closing bolt gun fires by itself. Fired three times in a row even without ammo in gun. jbi

Firearm Information

DOM Mfg. Model/Ga. SKU Serial Bbl. Type 700/270 6/8/2004 10:41:27 Remington CF/BA 26123 D6601247 PY WIN AM

Date Original Where Purchased Accessories Purchased Owner

GLENN ZANDERS FUR & U **SPORT**

CONCERN: FBC

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Reim. Cash Cash Settlement Release of Claims Release Date Date Reimbursement Date Settlement APV

Offer to replace trigger assembly, check over, and test at 50% discount

Repair/Replacement Repair/Replacement

10/16/13: Per Ilion, trigger set screws altered. Trigger has no sear engagement. Replace trigger assembly, check over, and test at 1/2 normal cost. jbi 10/18/13: I call and left quote on customer's voicemail. I received call from Mr. Fryman, he approved quoted with credit card. jbi

http://cps03sp01.remington.com:99/Remington_PSA/PrintDisplay.aspx?ID=9302&Type...

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		10/15/2013
Examination	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4006	Altered Adjustments or Components	
	Description		22" 270 WIN
	Date Code		PY
	Bore Plugged	False	
Barrel	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Manada	Condition	Select	
Magazine	Box Condition	Slightly Worn; Functioning	
	Exterior Condition	Slightly Worn; Not Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
	Description		STANDARD SAFETY
Safety	Function	Like new; Functioning	
	Sub-Assembly	ISS	
	Lift	Select	N/A
Sear	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
	Condition	Slightly Worn; Not Functioning	NO TRIG RETURN UNDER SEAR

 $http://cps03sp01.remington.com: 99/Remington_PSA/PrintDisplay.aspx?ID=9302\&Type... \\ 10/18/2013$

		Pull	Select	N/A				
Tri	Trigger	Altered	True	SET SCREWS ALTERED				
		Sub-Assembly	M/700 Non-Bolt Lock					

Quotation

Remington Service PO Box 700

Estimating Report

Madison, NC 27025-0700

Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

All PRICES QUOTED ARE IN EXCHANGE FOR REPLACED PARTS.

THIS IS NOT AN INVOICE. THIS IS AN ESTIMATE TO REPAIR, RECONDITION, OR REPLACE THE ITEM(S) DESCRIBED BELOW. IF THIS IS SATISFACTORY, PLEASE APPROVE BY SIGNING BELOW AND RETURNING TO THE ABOVE ADDRESS. REPAIR TO TAKE APPROXIMATELY (6) WEEKS AFTER RECEIPT OF APPROVAL. IF WE DO NOT RECEIVE YOUR APPROVAL IN 21 DAYS, WE WILL RETURN THE ITEM(S) AS RECEIVED, POSTAGE DUE.

Repair Number Serial Number / Description RE00323841 D6601247 Model 700 Center Fire Caliber: 270 win dm			1	Estir			Date:	10/14/20 10/15/20 10/18/20	013	
Customer: ANDREW FRYMAN 10008 ORION DRIVE TEMPLE, TX 76502 US				Return To: ANDREW FRYMAN 10008 ORION DRIVE TEMPLE, TX 76502 US						
Please Circle One VISA MC Open Account	DISCOVER	Card No PO Number:			Ехр	.Date				
Approval Signatur Daytime Phone	e: ()		ne to Call: _			Date:				
Reported M123 - FORW	ARD TO PROI	lease use the reverse side for your comm I DUCT SERVICE FOR INSPECTION JT PULLING THE TRIGGER	Problems Found M123	rk this bo	ARD TO PRO	DUCT SER	VICE FOR	INSPE	CTION	
trigger assembly s	et screws alter	Technic d, trigger has no sear engagement replace	cian Comme e trigger ass	nts embly,ch	eck over and te	est fire at 1/2	normal co	st.		
Material	Type EST	IMATE (note: C.O.D./Shipping and I Description	and the second	iarges ai Qty eeded	e NOT-Includ Warranty	ed in this Q Qty From Inv	uote.) Price		Amount	
F305570B 4000114 4000119	Part Service Service	X-MARK PRO 700 TRIG ASSB RH B GR-SHIPPING & HANDLING (GUN I GR-TEST		1 1 1	Billable Billable Billable	1 1 1	97.00 17.00 23.00	50 0 50	48.50 17.00 11.50	
						Est	Total: Sales Tax:		77.00 5.20 \$82.20	

Service Request

PO Box 700

Date of Request:

Date Printed: 09/25/2013

09/25/2013

Madison, NC 27025-0700

www.Remington.com

Parts and Repairs: P:800-243-9700/F:336-548-7801 This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCUMENT WITH YOUR RETURN.

ZZ

Service Request Number | Serial Number / Description SR00062655

D6601247

Model 700DM RIFLE Caliber: 270

Customer: ANDREW FRYMAN 10008 ORION DRIVE

TEMPLE, TX 76502 US

Destination:

Arms Services 14 Hoefler Ave Ilion, NY 13357 US

Email: andrew.t fryman.ctr@mail.mil

-Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M992 - GUN FIRES WITHOUT PULLING THE TRIGGER

Service Request Section WHEN CLOSING BOLT GUN FIRES BY ITSELF. FIRED THREE TIMES IN A ROW EVEN WITHOUT AMMO IN GUN.

Parts And Service Details 1. Price Disc Amount

Naterial Type Description On Warranty Price Disc Amount

Needed

D6601247



BY:

T.A. set screws Alt. TRIG. HAS NO SEAS Engagement. Mp. T.A. check over a tost AT 1/2 NORWA (60 ST.

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Snb Total: Est Sales Tax: .00 .00

Grand Total:

\$.00









