PrintDisplay Page 1 of 2

Remington Arms Co., Inc. Product Service Legal Case #:8559

Case Information

RE# Date Opened Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete 298948 1/31/2013 2/1/2013 2/1/2013

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact

Incident Regina Gabig 14340 Memorial Dr Houston TX 77079 E wesleycole54@yahoo.com

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

ΡĮ

PD Cause:4006 Altered Adjustments or Components
S Fired when safety removed Concern:1007 Fired on Safe Release
Unknown

Ċ

2/13/13 Per note on SR, firearm discharged when safety removed. Complete SMP program.cm

Firearm Information

Type Model/Ga. SKU Bbl. DOM Remington CF/BA 700/7MM REM MA n/a 6479799 DU 9/1/1971 **Date Purchased** Where Purchased Accessories Original Owner EVANS SPT GD SHREVEPT, LA SCOPE BASE U

CONCERN: FSR

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Settlement Date APV Date APV

Per Ilion, replace TPA, clean and test at BLSM program price

Repair/Replacement Cost Date
29.04 2/13/2013

2/13/13 Per Ilion, trigger assm dirty and set screws altered. Replace TPA, clean and test at BLSM program price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		2/1/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4006	Altered Adjustments or Components	IMPROPER MAINTENANCE
Barrel	Description		24" 7MM REM MAG
	Date Code		DU
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown	Slightly Worn; Functioning	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8559&Type=Case

2/13/2013

	Condition		
	Firing Pin	Slightly Worn; Functioning	
Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	SCRATCHES, DENTS
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description]	BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	.011
	Notch	Slightly Wom; Functioning	
	Tests	Test Fired	False
Feeding Test	16212	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,TRIG NOT RETURNING WILL FOLLOW DOWN
	Pull	Select	4#
	Altered	True	SET SCREWS ALTERED SEALANT MISSING
	Sub-Assembly	M/700 Bolt Lock]
Non-Remington Components	Description		SCOPE BASE

Service Request

Remington Service PO Box 700



Parts and Repairs: P:800-243-9700/F:336-548-7801

Madison, NC 27025-0700 www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCUMENT WITH YOUR RETURN.

24"

Service Request Number | Serial Number / Description

SR00041438

Model 700 RIFLE

6479799

Customer: REGINA GABIG 14340 MEMORIAL DR

HOUSTON, TX 77079 US

Date Printed: 01/22/2013

Date of Request:

01/10/2013

Destination:

Email:

Arms Services 14 Hoefler Ave

Rion, NY 13357 US

Email: wesleycole54@yahoo.com

Your request for service on the item(s) will be evaluated by our regairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M240 - BOLT LOCK SAFETY MODIFICATION

Service Request Section

FIREARM DISCHARGED WHEN SAFETY REMOVED COMPLETE SMP PROGRAM

Parts And Service Details Material

Type

Description

Qtv Needed

Marranis.

Price Disc Amount



T.A. dinky + set screws Alt. Mp. TPA, cleAN+ Test UND DEP Ron 70+

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Q

Sub Total: Est Sales Tax:

.00 .00

Grand Total:

\$.00

QUOTATION

Remington Arms Company, Inc. 870 Remington Dr. P.O. Box 700

Madison, NC 27025-0700

ESTIMATING REPORT

Parts/Repair

800-243-9700 336-548-7801

www.remington.com info@remington.com

ALLEPRICES QUOTED ARE IN EXCHANGE FOR REPLACED PARTS.

THIS IS NOT AN INVOICE. THIS IS AN ESTIMATE TO REPAIR, RECONDITION, OR REPLACE THE ITEM(S) DESCRIBED BELOW. IF THIS IS SATISFACTORY, PLEASE APPROVE BY SIGNING BELOW AND RETURNING TO THE ABOVE ADDRESS. REPAIR TO TAKE APPROXIMATELY (4) WEEKS AFTER RECEIPT OF APPROVAL. IF WE DO NOT RECEIVE YOUR APPROVAL IN 15 DAYS, WE SHALL RETURN THE ITEM(S) AS RECEIVED POSTAGE DUE.

Repair Order Number	rder Number Description/Serial Num				Date Received - 1/31/2013				
RE00298948	8948 6479799			Estimat	te Date -	2/1/2013			
Account # - R-				Curren	t Date -	2/1/2013			
Customer			Return T	0					
REGINA GABIG			REGINA	GABIG					
14340 MEMORIAL DR			14340 M	IEMORIA	L DR				
HOUSTON, TX 77079 US			HOUST	ON. TX 7	7079 US				
1									
Phone (H) (281)-728-2176		Fax							
Phone (W)		<u>Email</u>	wesleyco	le54@yaho	o.com				
DI. C' 1 O									
Please Circle One	Cond No		Eun	Data					
VISA MC AMEX DISCOVER			ехр.	Date					
PO Number									
Daytime Phone ()	Time To Call		Ор	en Acct. <u>R</u>					
Approval: Customer Signature			····		Date _				
If You Desire Any Change Plea	se Use The Reverse Side For Y	our Comments	s And Mark	This Box					
	Notice: We process checks e								
	Prob		_		20 W. 72	THE PROPERTY OF			
Reported		Found 2							
				on Land of the		Maria Maria			
M123 FORWARD TO P	RODUCT SERVICE	M123	FOR	WARD TO	PRODUCT	SERVICE F			
FOR INSPECTIO									
TOK MSI BETTO									
		Comments.	New York	140	51 600-2-0	er to me the			
ACCOUNTS OF THE PARTY AND ADDRESS OF THE	The Control of	Comments		X					
ProblemNotes trigger assembly	dirty and set screws altered	. replace trigg	ger plate ass	embly,clea	n and test fi	re under bolt			
lock program for	\$20.00 + shipping		•	·					
	•								
		<u></u>							
Estimate **C	O.D. /Shipping and Handlin	g Charges are	NOT Inclu	ded in this ()uote 🔭 💥	HER CONTRACT			
Material # Material Description		Qty	Warranty	Price/	Discount	Extended			
			Y/N	Unit	Percent	Amt			
Part			_						
F305570B X-MARK PRO 700	TRIG ASSB BH BLACK	0 1	Y	\$97.00	0%	\$0.00			
Service A-MARK PRO 100	1140 HOOD IGH DURION (· .	•	Ψ,1,00	U / U	ψ 0.00			
	AND MO CONTRE		3.7	Ø17 AA	001	617.00			
4000114 GR-SHIPPING & H	ANDLING CUN REPAIR) 1	N	\$17.00	0%	\$17.00			
	136. 17 , 7 , 7	1	N	\$20.00	0%	\$20.00			
4000119 GR-1ES1		1	Y	\$23.00	0%	\$0.00			
CSR. Ch	Mint			Sub Total	•	\$37.00			
WF10 mm romanum	× .								
Response			\$2.50						
1103hallaa	Naid-			a					
Doggano	/Ella:			Grand To	tal:	\$39.50			
V Caponca	/ I JUG 1								
I at .	//	<u>, 1</u>	1						
10'		(/ /	1						
	1 11. 100	\sim	.h	α					
	Ly/NW		ひと	4					
	~ / 								







