

Remington Arms Co., Inc.  
Product Service  
Legal Case #:8770

## Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
306895	4/3/2013	4/4/2013	4/4/2013				

## Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Glick Twins, Inc		Glick Twins, In	419 W. US Hwy 83	Pharr	TX	78577		W 956-787-4291 F 787-7950

## Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance			
S	Won't cock on closing, goes off without pulling trigger	Concern:1025 Unexplained Discharge - No Mention of Safety Position		Unknown
C				
4/8/13 Per note with rifle, won't cock on closing, goes off without pulling trigger, won't extract.cm				

## Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/2506 REM	29675	E6681046	DU	9/11/2000 11:04:59 AM
Date Purchased	Where Purchased	Accessories	Original Owner			
	SPORTS SOUTH INC		U			

CONCERN: WON'T COCK,GOES OFF WITHOUT PULLING TRIGGER

Ammunition Information - None Defined

Other Products Information - None Defined

## Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, offer to replace TPA, clean, test at 1/2 normal cost						
Repair/Replacment Cost	Repair/Replacement Date					
4/8/13 Per Ilion, trigger assm dirty and sticky, parts work sluggish. Can offer to replace TPA, clean, test at 1/2 normal cost.cm						

## Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		4/4/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4015	Improper Maintenance	
Barrel	Description		26" 2506 REM HB
	Date Code		DU
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	

Bolt	Firing Pin	Slightly Worn; Functioning	SLUGGISH
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	ISS	
Sear	Lift	---Select---	.016
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY PARTS SLUGGISH WILL FOLLOW DOWN
	Pull	---Select---	9#
	Altered	False	FACTORY SEALANT PRESENT
	Sub-Assembly	M/700 Non-Bolt Lock	

956-787-4291  
FAX 787-7950

~~956-787-4291~~  
~~FAX 787-7950~~

№ 092155

# GLICK TWINS, INC.

419 W. U.S. HIGHWAY 83 • PHARR, TX 78577  
TERMS: NET 10TH PROX. ON ALL CHARGE ACCOUNTS

8770

26"  
Du 9/2001  
9#  
.016

Customer's		Order No.		Date		3-27-13	
Name		Arms SERVICES (Remington Arms)					
Address		14 HOFFLER AVE. ILION, NY. 13357					
Phone:							
SOLD BY	CASH	C.O.D.	CHARGE	ON ACCT.	MDSE. RET'D	PAID OUT	LAYAWAY
QUAN.	DESCRIPTION					PRICE	AMOUNT
1	Remington Model 700						
	CAL. 25-06 Rem. Sendero						
	SN. # E6681046						
	RA. # SR00046562						
	RIFLE WON'T COCK ON closing,						
	GOES OFF WITH OUT PULLING						
	trigger, won't Extract.						
	PLEASE repair under warrn.						
All claims and returned goods MUST be accompanied by this bill.						TAX	

Serial Number:

E6681046

Model: 700



RE00306895

RECEIVED  
APR - 5 2013

BY: .....

T.A. dirty + sticky pants work  
sluggish. can offer to rep.  
TPA, e6 ANT TEST AT 1/2 cost.

Q









