

Remington Arms Co., Inc.
Product Service
Legal Case #:8673

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
302131	2/26/2013	3/4/2013	3/4/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Norman	Holmer	10980 E US 224	Attica	OH	44807		C 419-934-0112 E nshfarms@hotmail.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	Fired when closing bolt Concern:1008 Fired on Bolt Closing			
C				

3/5/13 Per note with rifle, firing pin releases when bolt is closed without pulling the trigger.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/22-250 REM	n/a	6402463	LU	2/1/1971
Date Purchased	Where Purchased	Accessories	Original Owner			
	BOB ERATH CO SO BEND IND	TWO PIECE BASE	N			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean and test at BLSM program price						

Repair/Replacement Cost	Repair/Replacement Date
29.04	3/5/2013

3/5/13 Per Ilion, trigger assm is contaminated with a dried and sticky lube residue causing parts to bind and work sluggish. Replace TPA, clean and test at BLSM program price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		3/4/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS

Cause	4015	Improper Maintenance	
Barrel	Description		24" 22-250 REM HB
	Date Code		LU
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Like new; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	010
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DRIED AND STICKY RESIDUE PARTS BIND, WORK SLUGGISH WILL FOLLOW DOWN
	Pull	---Select---	6#
	Altered	True	SEALANT MISSING
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		TWO PIECE BASE

Feb. 21, 2013

24"
Luz/71
6#
.010

This rifle was purchased second-handed
somewhere 1973 to 1976. Can't find 8673
proof of purchase.

Norman Holmer

10980 E. 45 224

Attico, Ohio 44807

cell phone 419-934-0112

Problem: fire-pin release when bolt is closed
without pulling trigger.

Serial
Number:

6402463

Model: 700



RE00302131

RECEIVED
MAR 05 2013

BY:.....

T.A. is contaminated w/ a dried
+ sticky lube residue causing
parts to bind + work sluggish.
Rpt. TPA, CLEAN-TEST and RCP
Run 20 +

Q





