PrintDisplay Page 1 of 3

> Remington Arms Co., Inc. **Product Service** Legal Case #:9127

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Lit Obsolete

8/19/2013 8/20/2013 8/20/2013 318503

Customer Information

First Last Type Business Street City State Zip Age Contact

Name Name

H 512-413-2118 1101 Carlos G Paker Incident Hubnik Taylor TX 76574 Steven Blvd NW

steven_h@babecoinc.com

Incident Information

Claims Codes Repair Est. **Medical Treatment** Medical Status

Ρľ

PD Cause: 4015 Improper Maintenance **FSR** S

Unknown Concern: 1007 Fired on Safe Release

C

Per SR00058669 Service Request Section, customer states the rifle will discharge when safety is moved. jbi

Firearm Information

SKU Model/Ga. Serial Bbl. DOM Mfg. Type 700/2506 REM 6389092 RT 11/1/1970 Remington CF/BA n/a Date Original

Where Purchased Accessories Purchased Owner

WACO HDW. CO. WACO, TWO PIECE U **TEXAS** BASE

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Reim. Cash Cash Release of Claims Settlement **Release Date** Reimbursement Date Date Settlement APV

Replace trigger assembly under BLP for \$20.00 + shipping and replace bolt at 25% discount

Repair/Replacement Repair/Replacement

8/21/13: Per Ilion, "trigger assembly dirty, sticky & set screws altered, trigger is frozen to sideplates. Replace trigger assembly and test fire under bolt lock program for \$20.00 + shipping. Fit over size bolt to correct headspace at 25% discount." 8/22/13: I called Steven Hubnik and he approved the quote with a credit card. jbi

Examination[Remington/CF/BA]

http://cps03sp01.remington.com:99/Remington_PSA/PrintDisplay.aspx?ID=9127&Type=... 8/22/2013

Part	Sub-Part	Code	Comment
	Examiner		B.TRAVIS
	Exam Date		8/20/2013
Examination	Product Type	ĺ	RF
	Action Type	j	A
	Assigned To		S.NICHOLS
Cause	4015	Improper Maintenance	
	Description	}	24" 2506 REM
	Date Code]	RT
	Bore Plugged	False	
	Bulged	False]]
l Barrel			<u> </u>
Duiter	Fired	False	J
	Fired while Obstructed		
	Muzzle/Crown	Slightly Worn;	
	Condition	Functioning	
	Firing Pin	Slightly Worn;	
	I ming i m	Functioning	
	Shroud	Slightly Worn;	
		Functioning	_
Bolt	Face	Slightly Worn;	
	Handle	Functioning Slightly Worn;	
	Handle	Functioning	<u> </u>
	Stop	Slightly Worn; Not Functioning	BINDS
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select]
Locking	Lug Condition	Worn; Not Functioning	HAS AN EXTREME MAX HEADSPACE COND.
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Not Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	1
Safety	Description		BOLT LOCK SAFETY
		Like new; Functioning]

http://cps03sp01.remington.com:99/Remington_PSA/PrintDisplay.aspx?ID=9127&Type=... 8/22/2013

Sear	Lift	Select	.007	
	Notch	Slightly Worn; Functioning		
	Tools	Test Fired	False	
Feeding Test	Tests	False		
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY STICKY.TRIG FROZEN TO SIDE PLATES	
	Pull	Select	10+# WOULD NOT MOVE	
	Altered	True	SEALANT MISSING	
	Sub-Assembly	M/700 Bolt Lock		
Non-Remington Components	Description		TWO PIECE BASE	

Quotation

Remington Service PO Box 700

Madison, NC 27025-0700

Estimating Report


Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

 
All PRICES QUOTED ARE IN EXCHANGE FOR REPLACED PARTS.

THIS IS NOT AN INVOICE. THIS IS AN ESTIMATE TO REPAIR, RECONDITION, OR REPLACE THE ITEM(S) DESCRIBED BELOW. IF THIS IS SATISFACTORY, PLEASE APPROVE BY SIGNING BELOW AND RETURNING TO THE ABOVE ADDRESS. REPAIR TO TAKE APPROXIMATELY (6) WEEKS AFTER RECEIPT OF APPROVAL. IF WE DO NOT RECEIVE YOUR APPROVAL IN 21 DAYS, WE WILL RETURN THE ITEM(S) AS RECEIVED, POSTAGE DUE.

Repair Number RE00318503	638	rial Number / Description 89092 odel 700 Center Fire Caliber: 25-06	Date Received: Estimate Date: Date Printed:	08/19/2013 08/20/2013 08/22/2013							
Customer: STEVEN HUBNIK 1101 CARLOS G PAKER BLVD NW				Return To: STEVEN HUBNIK 1101 CARLOS G PAKER BLVD NW							
TAYLOR, TX 76574 US			TAYLOR, TX 76574 US								
Please Circle One		Cond No.		Evn I	Pata						
VISA MC DISCOVER Card No. Exp.Date Open Account: R PO Number:											
Approval Signatu	те:	Time			Date:						
Daytime Phone	e: ()	Time	to Call:	hic hay							
If you desire any change, please use the reverse side for your comments and mark this box. Problems											
		DUCT SERVICE FOR INSPECTION Y MODIFICATION	MI23 - I	HEADSPACE IS EXCI FORWARD TO PROD BOLT LOCK SAFETY	UCT SERVICE FOI	RINSPEC	CTION				
Technician Comments trigger assembly dirty, sticky & set screws altered, trigger is frozen to sideplates replace trigger assembly and test fire under bolt lock program for \$20.00 + shipping. fit over size bolt to correct headspace at 25% discount											
Material	Type ES	TIMATE (note: C.O.D./Shipping and Har Description	idling Char Qt Need	y Warranty	l in this Quote.) Qty Price From Inv	Disc	Amount				
F27341 F305570B F92897 F97322 4000114 4000116 4000119	Part Part Part Service Service Service	700 EXTRACTOR RIVET MAGNUM X-MARK PRO 700 TRIG ASSB RH BLA 700 BOLT ASSB BDL MAX LONG F1 700 EXTRACTOR MAGNUM GR-SHIPPING & HANDLING (GUN RE GR-LABOR GR-TEST) 1 1	Warranty Billable Billable Billable Billable	1 4.00 1 .00 1 140.00 1 13.00 1 17.00 20 1.00 1 .00	0 25 25 0	3.00 .00 105.00 9.75 17.00 20.00 .00				
					Sub Total: Est Sales Ta Grand Total		154.75 10.45 \$165.20				

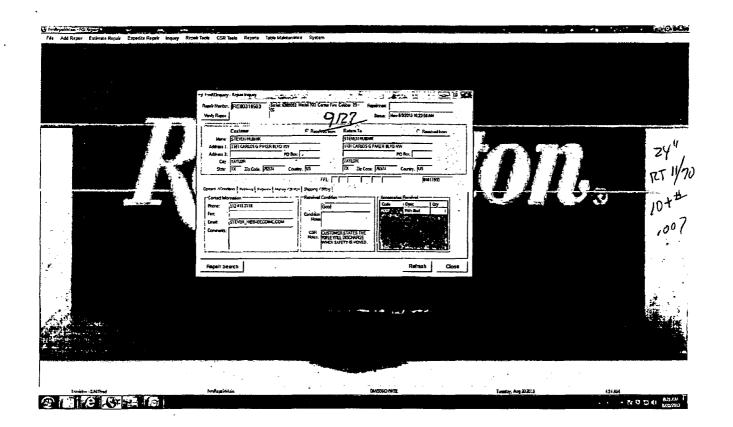





BY:

PIPLE has A MAX LEADS PACE condition will Quote for ownsize TOUT At 25% DISC.

T. A. Lipty, Sticky & Set Screws

Alt. Trong. IS Frozen to Side plants

twill not move. Not. TRA, clean x rest

und BLP Con 20 t

9



