PrintDisplay Page 1 of 2

> Remington Arms Co., Inc. **Product Service** Legal Case #:9016

Case Information

Pre Lit Lit Obsolete RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** 

314410 6/27/2013 6/28/2013 6/28/2013

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact

Joldersma 4663 Helen Hwy. Sautee GA 30571 Incident Mike

H 706-969-4176 E eaglerock696@yahoo.com

Incident Information

Repair Medical Medical Claims Codes Est. Treatment Status

ΡI

PD Cause:4038 Could Not Duplicate Concern

Concern:1025 Unexplained Discharge - No Mention of Unknown Fires at

Safety Position will

C

Service Request SR00055586. CSR notes on repair "Safety Modification Program". Customer's note "Fires at will".

Firearm Information

Mfg. Model/Ga. SKU Serial Bbl. DOM Type

700/270 Remington CF/BA n/a A6626821 OQ 6/1/1978 WIN

Original Date Where Purchased Accessories Purchased Owner

ARMSCO DIST CORP NASHVILLE **SLING** U TN

CONCERN: FIRES AT WILL

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Reim. Cash Cash Release of Claims Reimbursement Settlement Release Date Date Date Settlement APV

Per Ilion, quote to repair BLM

> Repair/Replacement Repair/Replacement Cost Date

> > \$29

7/16/13: Per Ilion, Could not dup. concern. Trigger assembly dirty and sticky. Replace TPA, clean, and test under BLP. jbi 7/17/13: I called customer & he apprvd & paid by CC#. df

Examination[Remington/CF/BA]

http://cps03sp01.remington.com:99/Remington\_PSA/PrintDisplay.aspx?ID=9016&Type=... 7/17/2013

Page 2 of 2

Part	Sub-Part	Code	Comment		
	Examiner		B.TRAVIS		
	Exam Date		6/28/2013		
Examination	Product Type		RF		
	Action Type		Α		
	Assigned To		S.NICHOLS		
Cause	4038	Could Not Duplicate Concern			
	Description		22" 270 WIN		
	Date Code		OQ		
	Bore Plugged	False			
Barrel	Bulged	False			
	Fired	False			
	Fired while Obstructed		•		
	Muzzle/Crown Condition	Slightly Worn; Functioning			
	Firing Pin	Slightly Worn; Functioning			
	Shroud	Slightly Worn; Functioning			
Bolt	Face	Slightly Worn; Functioning			
	Handle	Slightly Worn; Functioning			
	Stop	Slightly Worn; Not Functioning	BINDS		
Extractor	Condition	Slightly Worn; Functioning			
	Cut Condition	Slightly Worn; Functioning			
	Ext/Eject Test	False			
Locking	Block Condition	Select			
	Lug Condition	Slightly Worn; Functioning			
	Notch Condition	Select			
	Exterior Condition	Slightly Worn; Functioning			
Overall	Stock Condition	Slightly Worn; Functioning	MARS,SCRATCHES		
	Fore End Condition	Select			
Receiver	Condition	Slightly Worn; Functioning			
	Bulged	False			
Safety	Description		BOLT LOCK SAFETY		
		Like new; Functioning			
Sear	Lift	Select	.009		
	Notch	Slightly Worn; Functioning			
		Test Fired	False		
Feeding Test	Tests	False			
	Condition	Slightly Worn; Functioning	DIRTY,STICKY		
Trigger	Pull	Select	5.5#		
	Altered	False	SEALANT PRESANT		
	Sub-Assembly	M/700 Bolt Lock			
Non-Remington Components			SLING		

http://cps03sp01.remington.com:99/Remington\_PSA/PrintDisplay.aspx?ID=9016&Type=... 7/17/2013

## Quotation

## Remington Service PO Box 700

Madison, NC 27025-0700

Estimating Report


Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

All PRICES QUOTED ARE IN EXCHANGE FOR REPLACED PARTS.

THIS IS NOT AN INVOICE. THIS IS AN ESTIMATE TO REPAIR, RECONDITION, OR REPLACE THE ITEM(S) DESCRIBED BELOW. IF THIS IS SATISFACTORY, PLEASE APPROVE BY SIGNING BELOW AND RETURNING TO THE ABOVE ADDRESS. REPAIR TO TAKE APPROXIMATELY (6) WEEKS AFTER RECEIPT OF APPROVAL. IF WE DO NOT RECEIVE YOUR APPROVAL IN 21 DAYS, WE WILL RETURN THE ITEM(S) AS RECEIVED, POSTAGE DUE.

Repair Number	Sei	rial Number / Description	* *************************************		Date Receiv	ved:	06/27/2	2013		
RE00314410		626821			Estimate D		06/28/2			
	Mo	del 700 Center Fire Caliber: 270 WIN			Date Printe	:d:	07/17/2	2013		
Customer:			Retu	ırn To;						
MIKE JOLDI			MIKE JOLDERSMA							
4663 HELEN HWY			4663 HELEN HWY							
SAUTEE, G.	A 30571 US			SAUTEE, GA 3	30571 US					
Please Circle One		Cond No		F	Data					
VISA MC Open Accoun		PO Number:	Exp.Date							
	•				_					
Approval Signatu Daytime Phon		Time	to Call:		Date:					
		please use the reverse side for your commen						<del></del>		
	197		blems			-		3 4 5 5 5		
Reported		DUOT OUN WOLF FOR WOOD OWN	Found			محضحت				
		DUCT SERVICE FOR INSPECTION CHECKS ON TRIGGER ASSEMBLY		WARD TO PROI AN & INSPECT (						
MISTO PERG	, and the second	CILDORO GIV HAGODIC ADDENDE		LOCK SAFET			ONLI	,		
in the secretary	Train of the second	Technicia	n Comments		1			The Habitan		
could not duplica	te concern. trig	gger assembly dirty and sticky, replace trigg			ler bolt lock pro	ogram f	or \$20.0	00 + ship		
ping										
	ES	TIMATE (note: C.O.D./Shipping and Ha Description		re NOT Include						
Material	Type	Description	Qty Needed	Warranty	Qty From Inv	Price	Disc	Amount		
F305570B	Part	X-MARK PRO 700 TRIG ASSB RH BLA		Warranty	1	.00	0	.00		
4000114 4000116	Service Service	GR-SHIPPING & HANDLING (GUN RE GR-LABOR	PAIR) 1 20	Billable		7.00	0	17.00		
4000119	Service	GR-TEST	1	Billable Warranty	20 1	1.00	0 0	20.00 .00		
				·						
					_					
					J) .					
			Ц		ע					
				7/17/17	3 df					
				"   1 1 1 1 -	) (1)					
								,		
					Sub To	tal:		37.00		
					Est Sal			.00		
					Grand	Total:		\$37.00		

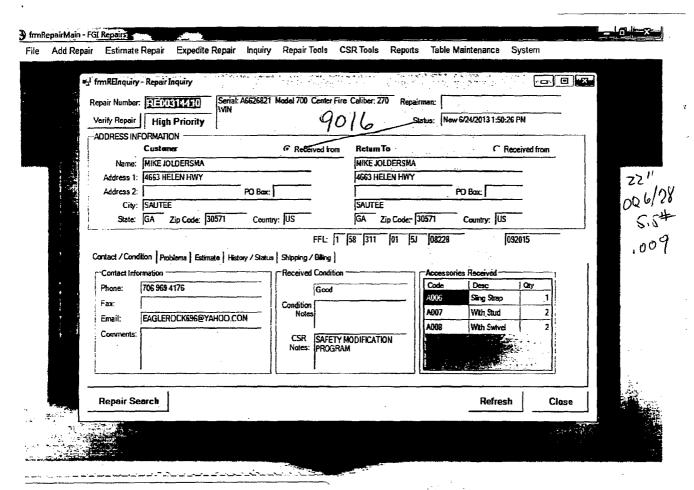

A6626821 Model: 700



5# A6676821 1.270 CAL FIRES AT WILL DMJ506CHW7JL Friday, Jun 28 2013 4:50 AM 6:34 AM 6:728/2013

PECEUVE L JJL 1 6 2013

BY:-----

could not dup corcero. T. A. dinky + Sticky. Ry. TAM, CO ANT TOST UND. BLP Cor 20 +

Q





