

Remington Arms Co., Inc.
Product Service
Legal Case #:8696

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
304152	3/11/2013	3/12/2013	3/12/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Bill	Kallaher	13620 Cty CR 4178	Lindale	TX	75771		H 903-216-3132 E bkallaher@chemical.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015	Improper Maintenance		
S	Unexplained Discharge	Concern:1025	Unexplained Discharge - No Mention of Safety Position	Unknown
C				

SR# 46606 - Reason for Return: Fails to Fire. Service Request Section: Gun accidentally discharged and then will not fire at all. df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/7MM08 REM	25799	C6495941	BK	1/31/1990
Date Purchased	Where Purchased	Accessories	Original Owner			
	SPORTS SOUTH INC	SCOPE,RINGS,BASE,SLING	U			

CONCERN: ACCIDENTAL DISCHARGE

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair @ 1/2 normal cost						
	Repair/Replacement Cost	Repair/Replacement Date				

3/13/13: Per Ilion - TA has dried lube residue causing sear to bind to side plates. Can offer to replace TA, clean & test at 1/2 normal cost - quote. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		3/12/2013
	Product Type		RF
	Action Type		A

	Assigned To	S.NICHOLS	
Cause	4015	Improper Maintenance	
Barrel	Description		22" 7MM 08 REM
	Date Code		BK
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	N/A
	Notch	Slightly Worn; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DRIED LUBE RESIDUE, SEAR BINDS TO SIDE PLATES
	Pull	---Select---	10+#
	Altered	False	SEALANT PRESANT
	Sub-Assembly	M/700 Non-Bolt Lock	

[illegible]

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. **PLEASE RETAIN THIS COPY FOR YOUR RECORDS.**

22"
32 1/9
10 + #

8696

M110 - FAILS TO FIRE

GUN ACCIDENTALLY DISCHARGED AND THEN WILL NOT FIRE AT ALL

Serial Number:

RECEIVED
MAR 13 2013
BY:.....

T.A. has dried lube residue causing seal to bind to side plates. can offer to run TPA, clean + test at 1/2 normal cost.

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

PS 32671







