

Remington Arms Co., Inc.
Product Service
Legal Case #:8882

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
309962	5/3/2013	5/6/2013	5/6/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		William	Labelle	119 McClure Dam Rd	Negaunee	MI	49866		H 906-250-2498 E porblabelle@hotmail.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015	Improper Maintenance		
S	Fired while unloading	Concern:1025	Unexplained Discharge - No Mention of Safety Position	Unknown
C				

5/9/13 Per note on SR, "PER CONSUMER, GUN FIRED WHILE UNLOADING".cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	70919	OK	7/1/1963
Date Purchased	Where Purchased	Accessories	Original Owner			
			U			

CONCERN: FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean and test at BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				

5/9/13 Per Ilion, could not duplicate concern. Trigger assm dirty and sticky causing parts to work sluggish. Replace TPA, clean and test at BLSM program price. Quote for stock.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		5/6/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS

Cause	4015	Improper Maintenance	
Barrel	Description		20" 3006 SPRG
	Date Code		OK
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	MARS,DENTS
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.006
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY,STICKY PARTS SLUGGISH
	Pull	---Select---	3#
	Altered	True	SEALANT MISSING
	Sub-Assembly	M/700 Bolt Lock	

Service Request

Remington Service

PO Box 700


Madison, NC 27025-0700

www.Remington.com

Parts and Repairs: P:800-243-9700/F:336-548-7801

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. **ENCLOSE THIS DOCUMENT WITH YOUR RETURN.**

201
OK 7/6
32
106

Service Request Number SR00050603	Serial Number / Description 70919 Model	Date of Request: 04/15/2013 Date Printed: 04/15/2013
Customer: WILLIAM LABELLE 119 MCCLURE DAM ROAD NEGAUNEE, MI 49866 US	Destination: Arms Services 14 Hoeffer Ave Ilion, NY 13357 US	
Email: PORB LABELLE @ Hotmail . Com		Email:
Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.		
Reason For Return M240 - BOLT LOCK SAFETY MODIFICATION		
Service Request Section PER CONSUMER, GUN FIRED WHILE UNLOADING. I would like a price for a new wood stock		
Parts And Service Details		
Material	Type	Description
		Qty Needed
		Warranty
		Price Disc Amount
Serial Number: 70919 Model: 700		
		
RE00309962		
RECEIVED MAY 08 2013		
BY:		
could not sup. concern J.D. dirty & sticky causing parts to work sluggish. Rup. TPA, clean & test and. BCL Ron 20 & PAX Reg. To Quote Con. stic.		
THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the item(s) being sent based on the conversation with our representative.		
Sub Total: .00 Est Sales Tax: .00 Grand Total: \$.00		



