

Remington Arms Co., Inc.
Product Service
Legal Case #:9634

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
330046	12/6/2013	12/9/2013	12/9/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	Midwestern Shooters Supply	---	Midwestern Shoo	191 State Road 67	Lomira	WI	53048		W 920-269-4995 F 920-269-2133

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4006	Altered Adjustments or Components		
S	FSR	Concern:1007	Fired on Safe Release	Unknown
C				

Dealer sent gun into Ilion w/note. Dealer stated - "Owner said gun fired on its own after moving safety to the fire position". df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/270 WIN	26909	T6263202	KX	5/12/2003 8:22:41 AM
Date Purchased	Where Purchased	Accessories	Original Owner			
	MIDWESTERN SHOOTERS SUPPL	TWO PIECE BASE	U			

CONCERN: FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV

Per Ilion - Quote to repair @ a discount

Repair/Replacement Cost	Repair/Replacement Date

12/10/13: Per Ilion - Could not duplicate concern. TA set screws altered. Replace TA, check over & test at 1/2 cost. Replace recoil pad at n/c. - quote. df 12/30/13: No response to quote. Faxed quote to dealer. df 12/31/13: CSR spoke w/customer - quote apprvd & pd. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		12/9/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4006	Altered Adjustments or Components	
Barrel	Description		24" 270 WIN SS
	Date Code		KX
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Functioning	
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Magazine	Condition	---Select---	
	Box Condition	Missing	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		STANDARD SAFETY
	Function	Like new; Functioning	
	Sub-Assembly	ISS	
Sear	Lift	---Select---	.010
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
	Condition	Slightly Worn; Functioning	DIRTY

Trigger	Pull	---Select---	5#
	Altered	True	SET SCREWS ALTERED
	Sub-Assembly	M/700 Non-Bolt Lock	

Quotation

Remington Service

PO Box 700

Madison, NC 27025-0700

www.Remington.com

Estimating Report

* Parts and Repairs: P:800-243-9700/F:336-548-7801

All PRICES QUOTED ARE IN EXCHANGE FOR REPLACED PARTS.

THIS IS NOT AN INVOICE. THIS IS AN ESTIMATE TO REPAIR, RECONDITION, OR REPLACE THE ITEM(S) DESCRIBED BELOW. IF THIS IS SATISFACTORY, PLEASE APPROVE BY SIGNING BELOW AND RETURNING TO THE ABOVE ADDRESS. REPAIR TO TAKE APPROXIMATELY (6) WEEKS AFTER RECEIPT OF APPROVAL. IF WE DO NOT RECEIVE YOUR APPROVAL IN 21 DAYS, WE WILL RETURN THE ITEM(S) AS RECEIVED, POSTAGE DUE.

Repair Number	Serial Number / Description	Date Received:
RE00330046	T6263202	12/07/2013
	Model 700 Center Fire Caliber: 270 WIN	Estimate Date: 12/09/2013
		Date Printed: 12/30/2013

Customer:
MIDWESTERN SHOOTERS SUPPLY
191 STATE ROAD 67
LOMIRA, WI 53048 US

Return To:
MIDWESTERN SHOOTERS SUPPLY
191 STATE ROAD 67
LOMIRA, WI 53048 US

Please Circle One: ☒

* VISA MC DISCOVER Card No. _____ Exp.Date _____

* Open Account: R _____ PO Number: _____

* Approval Signature: _____ Date: _____

Daytime Phone: (____) _____ Time to Call: _____

☐ If you desire any change, please use the reverse side for your comments and mark this box.

Problems

Reported

M123 - FORWARD TO PRODUCT SERVICE FOR INSPECTION

Found

M123 - FORWARD TO PRODUCT SERVICE FOR INSPECTION

Technician Comments

could not duplicate concern.trigger assembly set screws altered.replace trigger assembly,check over and test fire at 1/2 normal cost.

ESTIMATE (note: C.O.D./Shipping and Handling Charges are NOT Included in this Quote.)

Material	Type	Description	Qty Needed	Warranty	Qty From Inv	Price	Disc	Amount
F305571B	Part	700 X-MARK PRO TRIG ASSB RH SILVER (OS)	1	Billable	1	97.00	50	48.50
4000114	Service	GR-SHIPING & HANDLING (GUN REPAIR)	1	Billable	1	17.00	0	17.00
4000119	Service	GR-TEST	1	Billable	1	23.00	50	11.50

PAID

12/31/13

Sub Total: 77.00

Est Sales Tax: 3.85

Grand Total: \$80.85

TRANSMISSION VERIFICATION REPORT

TIME : 12/30/2013 15:56
NAME :
FAX :
TEL :
SER.# : BROJ2J401571

DATE, TIME	12/30 15:55
FAX NO./NAME	19202692133
DURATION	00:00:24
PAGE(S)	01
RESULT	OK
MODE	STANDARD ECM



PO Box 26 · 191 Church Street · Lomira WI 53048
Phone (920) 269-4995 Fax (920) 269-2133

9634

24"
12x5/03
5#
.010

Date 12-03-13 Telephone _____

Name REMINGTON ARMS CO.

Address ILION, N.Y.

~~BUYER'S SIGNATURE~~ _____

QUAN	DESCRIPTION	PRICE
	M-700 DM/SYN.CAL. 270	
	# T6263202 (NO MAGAZINE)	
	OWNER SAID GUN FIRED ON ITS	
	OWN AFTER MOVING SAFETY	
	TO THE FIRE POSITION	
①	UPGRADE TRIGGER ASSEM. TO	
	X-MARK PRO	
②	BAD RECOIL PAD	

RECEIVED
DEC 10 2013

BY:.....

TERMS: DUE UPON RECEIPT SIGNED: Thank
D J Chedel

T6263202

Model: 700



RE00330046

could not dup. concern
T.A. set screws A1+. Rep
T.A. check over + test at
1/2 cost. Rep. recoil pad AT N/C
Q







