

Remington Arms Co., Inc.
Product Service
Legal Case #:8842

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
308788	4/23/2013	4/24/2013	4/24/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Norman	Minatani	202 Pelican Dr SE	Moses Lake	WA	98837		H 509-765-9225 E izumimin@gmail.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	Fires when chambering a round	Concern:1008 Fired on Bolt Closing		
C				

4/26/13 Per note on SR, going off, when he chambers a round in the chamber, without pulling the trigger.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPR	n/a	A6881576		2/26/1980
Date Purchased	Where Purchased	Accessories	Original Owner			
	SIMMONS GUN SPECIALTIES INC		U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace trigger assembly, clean and test fire at BLSM price						
	Repair/Replacement Cost	Repair/Replacement Date				
	29.04	4/26/2013				

4/26/13 Per Ilion, trigger assembly has a dried and sticky lubrication residue causing parts to bind. Replace trigger assembly, clean and test fire under bolt lock program for \$20.00 + shipping.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		4/24/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4015	Improper Maintenance	
Barrel	Description		22" 3006 SPRG
	Date Code		LA
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Scar	Lift	---Select---	.011
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DURED AND STICKY LUBE RESIDUE PARTS BINDING WILL FOLLOW DOWN
	Pull	---Select---	9.5#
	Altered	False	FACTORY SEALANT PRESANT
	Sub-Assembly	M/700 Bolt Lock	

Service Request

Marlin Service

PO Box 1871

Madison, NC 27025-1871



Parts and Repair: 2-800-544-8892 F336-548-7801

www.marlinfirearms.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCUMENT WITH YOUR RETURN.

22"
LA
2/PC
9.5th
011

Service Request Number SR00050465	Serial Number / Description A6881576 Model 5793	Date of Request: 04-12-2013 Date Printed: 04-12-2013
Customer: NORMAN MINATANI 202 PELICAN DR. SE MOSES LAKE, WA 98937 US		Destination: Arms Services 14 Hoeller Ave Hickory, NY 13357 US
Email: txumina@gmail.com		Email:
Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.		
Reason For Return M123 - FORWARD TO PRODUCT SERVICE FOR INSPECTION		
Service Request Section Going off when he chambers a round in the chamber, without pulling the trigger.		
Parts And Service Details		
Material	Type	Description
		Qty Needed
		Warranty
		Price
		Disc
		Amount

Serial Number: A6881576
Model: 700

RE00308788

RECEIVED
APR 26 2013
BY: _____

T.A. has a dried & sticky tube residue causing parts to bind.
Rpt TPA, clean & just work. BLP
COR 20 +
Q

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Sub Total:	.00
Est Sales Tax:	.00
Grand Total:	\$.00







