Remington Arms Co., Inc.
Product Service
Legal Case #:8440

Legal Case #:8440 Case Information RE# Date Opened Date Opened(PS) **Date Closed** Incident Date Pre Lit Lit Obsolete 295098 1/4/2013 1/7/2013 1/7/2013 Customer Information Type Business First Name Last Name Street City State Zip Age Contact 12431 County Rt 5 Chaumont Jeff NY 13622 E jeff_newton26@yahoo.com Incident Newton Incident Information Repair Medical Medical Claims Codes Treatment Est. Status ΡI PD Altered Adjustments or Cause:4006 Components Unknown Bolt releases firing pin when the bolt is S Concern: 1008 Fired on Bolt Closing closed 1/15/13 Per note on SR, customer says the bolt will release the firing pin when the bolt is lowered to the firing position.cm Firearm Information Mfg. Model/Ga. SKU Serial Bbl. DOM Type Remington CF/BA 700/280 REM 25797 C6681861 11/4/1991 **Date Purchased** Where Purchased Accessories Original Owner JERRYS SPORT CENTER INC U CONCERN:FBC Ammunition Information - None Defined Other Products Information - None Defined Settlement Remington/700/CF/BA Cash Cash Reim. Reimbursement Settlement Date APV Settlement Release of Claims Release Date Date APV Per Ilion, can offer to replace TPA, clean and test at 1/2 normal cost Repair/Replacement Repair/Replacement Date 1/15/13 Per Ilion, trigger assm is dirty and set screws are altered. Can offer to replace TPA, clean and test at 1/2 normal cost.cm Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/7/2013
	Product Type		RF
	Action Type		A
	Assigned To		J.BALIO
Cause	4006	Altered Adjustments or Components	
Barrel	Description		22" 280 REM
	Date Code		RL
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while		

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8440&Type=Case

1/15/2013

	Obstructed	1			
	Muzzle/Crown Condition	Slightly Worn; Functioning			
Bolt	Firing Pin	Slightly Worn; Functioning			
	Shroud	Slightly Worn; Functioning			
	Face	Slightly Worn; Functioning			
	Handle	Slightly Worn; Functioning			
	Stop	Slightly Worn, Functioning	SLUGGISH		
Extractor	Condition	Slightly Worn; Functioning			
	Cut Condition	Slightly Worn; Functioning			
	Ext/Eject Test	False			
Locking	Block Condition	Select			
	Lug Condition	Worn; Functioning	DID NOT CLOSE ON SAMMI OVERMAX		
	Notch Condition	Select			
Overall	Exterior Condition	Slightly Worn; Not Functioning			
	Stock Condition	Slightly Worn; Functioning			
	Fore End Condition	Select			
Receiver	Condition	Slightly Worn; Functioning			
	Bulged	False			
Safety	Description		STANDARD SAFETY		
	Function	Like new; Functioning]		
Sear	Lift	Select	.017		
	Notch	Slightly Worn; Functioning			
		Test Fired	False		
Feeding Test	Tests	False			
Trigger	Condition	Slightly Worn; Not Functioning	SEAR WORKING SLUGGISH TRIG NOT RETURNING PROPERLY WILL FOLLOW DOWN		
	Pull	Select	2#		
	Altered	True	SET SCREWS ALTERED		
	Sub-Assembly	M/700 Non-Bolt Lock			

Service Request

Service Request Number | Serial Number / Description

Remington Service PO Box 700



Date of Request: 12/12/2012

Madison, NC 27025-0700

www.Remington.com

Parts and Repairs: P:800-243-9700 F:336-548-7801 This forument is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service PLEASE RETAIN THIS COPY FOR YOUR RECORDS.

SR00038430	C6681861	,	16	Date	Printed:	12.12.2012
	Model 700 RIFLE Ca	رات : 180 ألف التأثير	سير ١٧٥٠			
Customer:	<u>.</u>	, X,		nation: Arms Services		
JEFF NEWTO				Anns Services 14 Hoefler Ave		
CHAUMONT,	, NY 13622 US	•		lion, NY 13357 US		
	rtonl6@yahoo.com			Email:		***
	rvice on the item(s) will be evaluate			under our warranty policy	If it is your fir	estur will be
repaired and returns	eś. If not, you will be contacted wi	th an estimate before wor	k u persormeć.			
1						
			···········			
Reason For Retu			· .			
MIS92 - BOLT						
Service Request S		•				
CUST SAYS THI	E BOLT WILL RELEASE THE F	FIRING PEN WHEN TH	E BOLT IS LOWER	ED TO THE FIRING PO	SITION .	
					•	
Parts And Service				Warranty	Price	Disc Amount
Material	Type Description		Qtr Needed	A STATE	rnte	Javann. Jau
•						

遠C6681861 Model:

T.A. dinty uset sciens altered. CAN offer to mp. TAN, che No. FOST At 1/2 MORIMA / COSt.

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Sub Totak Est Sales Tax: .00

JAN 0 9 2013





