

Remington Arms Co., Inc.
Product Service
Legal Case #:8539

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
298271	1/25/2013	1/29/2013	1/29/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Tom	Orlando	PO Box 144 7570 Lucas Dr	Side Lake	MN	55781		E tommyo@q.com

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S	Discharged when bolt was lifted	Concern:1020 Fired on Bolt Opening		
C				

2/14/13 Per note on SR, sending for safety modification program. Gun will discharge when bolt is lifted. Trigger was locked up.cm

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	A6822305	DV	9/23/1979
Date Purchased	Where Purchased	Accessories	Original Owner			
	SIMMONS GUN OLATHE KS		U			

CONCERN: FIRED WHEN BOLT LIFTED

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion, replace TPA, clean and test at BLSM program price						
	Repair/Replacement Cost	Repair/Replacement Date				
	29.04	2/14/2013				

2/14/13 Per Ilion, trigger assm has a dried and sticky lube residue causing parts to bind and work sluggish. Replace TPA, clean and test at BLSM program price.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		1/29/2013
	Product Type		RF
	Action Type		A
	Assigned To		J.BALIO
Cause	4015	Improper Maintenance	
Barrel	Description		22" 3006 SPRG
	Date Code		DV
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obsructed		

	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.009
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DRIED AND STICKY LUBE RESIDUE SEAR WORKS SLUGGISH WILL FOLLOW DOWN
	Pull	---Select---	5.5#
	Altered	False	SEALANT PRESANT
	Sub-Assembly	M/700 Bolt Lock	

Madison, NC 27025-1871

Parts and Repairs: P-800-544-8892 F-336-548-7601

www.marlinfirearms.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. **ENCLOSE THIS DOCUMENT WITH YOUR RETURN.**

Service Request Number SR00040559
Serial Number / Description A6822305
Model R5793

Date of Request: 01/04/2013
Date Printed: 01/04/2013

Customer:
TOM ORLANDO
PO BOX 144
7570 LUCAS DRIVE
SIDE LAKE, MN 55781 US
Email: tommyo@q.com

Destination:
Arms Services
14 Hoeller Ave
Elion, NY 13357 US

Email:

Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M295 - EVALUATE AND REPAIR SAFETY INSP.

Service Request Section

Safety modification program. ~~Gun will discharge when bolt was lifted. Trigger was locked up.~~

Parts And Service Details

Material	Type	Description	Qty Needed	Warranty	Price	Disc	Amount
----------	------	-------------	------------	----------	-------	------	--------

Serial Number:

A6822305

Model: 700



RE00298271

RECEIVED
JAN 31 2013

BY:

T.A. has a dried + sticky lube residue causing parts to bind & work sluggish. Rep. TRA, CLEAN fret and BCP Recoil w +

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Sub Total: .00
Est Sales Tax: .00
Grand Total: \$.00







