Remington Arms Co., Inc. Product Service Legal Case #:8648

				Legal Case #:8048					
Case Inform	mation								
RE# Date Opened 301078 2/18/2013		Date Opened(PS) Date Closed	Incident Date		Pre I	Lit Lit	Obsolete	
		2013	2/25/2013	2/25/2013					
Customer I	Information								
Type	Business	First Name	Last Name	Street	City	State	Zip A	.ge (Contact
Incident	*	Leonard Ted	Sheets	375 Blacklick Rd.	Millersport	OH	43046	H 74	0-467-3991
Incident In	formation								
Claims	s		Codes	Repa	ir Est. N	1edical	Treatment	Med	lical Status
PI									
PD		Cause:4015	Improper Mainter	Improper Maintenance Unknown					
S FSI	R	Concern:100	7 Fired on Safe Release						
С									
SR# 44584	- Service Re	equest Section:	Accidental discharg	e. Mr. Sheets included	a note that state	d: This	gun fires wi	thout anyor	ne touching
the trigger,	, if you bring	the bolt back ar	nd close it, and then	put the safety to the for	rward position t	he gun	will dry fire	every time.	. df
Firearm In		-		W 1 1/6	CIVI	•	<u> </u>		DOM
Mfg. Remington		Type CF/BA 70		Model/Ga. 00/7MM REM MA	SKU n/a		Serial 680560		DOM 12/1/1974
	urchased	Where Purchased		Accessories	Original Owner		000300	J XI	12/1/19/4
Date I urchaseu		nere a distance		710000001100	U				
CONCER	N:FSR								
Ammunitio	on Informatio	on - None Defin	ed						
Other Prod	lucts Informa	tion - None Def	fined						
Settlement									
				Remington/700/CF/BA	A				
_							Cash	Reim	Cash
Sett	lement	Release o	of Claims	Release Date	Reimbursen	nent	Settlemen		llate
	ner request - as received								AIV
		Repair/Repla	cement Cost Rep	air/Replacement Date		,			
2/28/13: Po	er Ilion - Cha		•	ce condition. Trigger as	sembly has a dr	ied & st	ticky lubrica	tion residue	causing part
				BLM - Quote. Replace b					

2/28/13: Per Ilion - Chamber has an extreme max headspace condition. Trigger assembly has a dried & sticky lubrication residue causing parts to bind & work sluggish. Replace TA, clean & test under BLM - Quote. Replace bolt to correct headspace at 25% discount - quote. Customer called in & is upset over being quoted for the repair. He feels it should be done at no charge. I went over our findings in the exam & he is fully aware of the condition of his rifle. Mr. Sheets asked me to returned the gun as received. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		2/25/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4015	Improper Maintenance	
Barrel	Description		24" 7MM REM MAG
	Date Code		XY
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed]	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8648&Type=Case

2/28/2013

l			,
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
Bolt	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning]
	Stop	Slightly Worn; Not Functioning	BINDS
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Block Condition		Select	
Locking	Lug Condition	Worn; Functioning	HAS EXTREME MAX HEADSPACE
	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Not Functioning	
Overall	Stock Condition	Slightly Worn; Functioning	SCRATCHES,MARS
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
Receiver	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
Salety	Function	Like new; Functioning	
	Lift	Select	.010
Sear	Notch	Slightly Wom; Functioning	
		Test Fired	False
Feeding Test	Tests	False	
Trigger	Condition	Select	DIRTY,STICKY PARTS BIND AND SLUGGISH WILL FOLLOW DOWN
	Pull	Select	10+#
	Altered	True	APPEARS PULL SCREW TURNED OUT AND RESEALED
	Sub-Assembly	M/700 Bolt Lock	

Service Request

Remington Service PO Box 700



Madison, NC 27025-0700

Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCUMENT WITH YOUR RETURN.

+114 10+#

ioli

Service Request Number

Serial Number / Description

SR00044584

6805605

Model Customer: LEONARD TED SHEETS

375 BLACKLICK RD MILLERSPORT, OH 43046 US

Email:

Date of Request:

02/08/2013

Date Printed:

02/08/2013

Destination:

Arms Services 14 Hoefler Ave

Ilion, NY 13357 US

Email:

Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return.

M310 - PERFORM SAFETY CHECKS ON TRIGGER ASSEMBLY

Service Request Section Accidental discharge.

Parts And Service Details Material

Type

Description

Qty Needed Warranty

Price

Disc Amount

FEB 2 6 2013 !

chamber has AN Extreme mix headspace condition.

Trig. Assmhus Adried + sticky pants to bind & work stuggish. Mp. TDA, CLANE TEST UNDER BCP Ron N 20, + ship, ship, ship, bolt to connect heads pace at

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the item(s) being sent based on the conversation with our representative.

Zs % disc.

Sub Total: Est Sales Tax: .00 .00

Grand Total:

\$.00

Remington 2/13/13

This note is to let you know how this gun fires without anyone touching the trigger. If you bring the bolt back and close it, and then put the safety to the forward position the gun will dry fire every time.

Ted Sheets 375 Blacklick Rd. Millersport Oh. 43046





