PrintDisplay Page 1 of 2

> Remington Arms Co., Inc. Product Service

Legal Case #:8594 Case Information Date Opened(PS) RE# Date Opened Date Closed Incident Date Pre Lit Lit Obsolete 299837 2/7/2013 2/8/2013 2/8/2013 Customer Information Type Business First Name Last Name City State Zip Age Street Contact H 440-724-0574 Incident Howard Strong Jr. 5706 Spring Grove Dr. Solon OH 44139 E howard.jr9556@sbcglobal.net Incident Information Claims Codes Repair Est. **Medical Treatment Medical Status** PD Cause:4006 Altered Adjustments or Components Unknown S FSR Concern:1007 Fired on Safe Release SR# 43801 - Service Request Section: Per Consumer the gun fires when safety is pushed off, df Firearm Information Mfg. Type Model/Ga. SKU Serial Bbl. DOM CF/BA 700/308 WIN A6522191 RO 11/1/1977 Remington n/a Original Owner **Date Purchased** Where Purchased Accessories W L BAUMLER CO LORAIN OH U CONCERN: FSR Ammunition Information - None Defined Other Products Information - None Defined Settlement Remington/700/CF/BA Cash Reim. Date Cash Date Release Date Settlement Release of Claims Reimbursement Settlement APV APV Per Ilion - Quote to гераіг Repair/Replacement Repair/Replacement Cost Date \$29 2/11/13: Per Ilion - Ejector is missing, TA dirty & set screws altered, replace TA, clean & test under BLM. Replace ejector at 1/2 normal cost - quote. df Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		2/8/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4006	Altered Adjustments or Components	
Barrel	Description		24" 308 WIN HB
	Date Code		RO
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8594&Type=Case

2/21/2013

PrintDisplay Page 2 of 2

	<u></u>		<b>≝</b>
Bolt	Firing Pin	Like new; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	]
	Stop	Slightly Worn; Functioning	SLUGGISH
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	Falsc	
Locking	Block Condition	Select	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	Select	
Overall	Exterior Condition	Slightly Worn; Not Functioning	EJECTOR IS MISSING
	Stock Condition	Slightly Worn; Functioning	GLASS BEDDED
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	]
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	[010
	Notch	Slightly Worn; Functioning	
	T .	Test Fired	False
Feeding Tes	Tests	False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY, TRIG NOT RETURNING WILL FOLLOW DOWN
	Pull	Select	2#
	Altered	True	SET SCREWS ALTERED SEALANT MISSING
	Sub-Assembly	M/700 Bolt Lock	

## Service Request

Marlin Service PO Box 1871



Date Printed: 01/31/2013

Madison, NC 27025-1871

Parts and Repairs: P:800-544-8892/F:336-548-7801

www.marlinfirearms.com

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service PLEASE RETAIN THIS COPY FOR YOUR RECORDS.

Date of Request: 01/31/2013

.010

Service Request Number | Serial Number / Description

A6522191

SR00043801

Model R5833

Customer: HOWARD STRONG JR 5706 SPRING GROVE DR

SOLON, OH 44139-1968 US

Destination: Arms Services 14 Hoefler Ave Ilion, NY 13357 US

Email: howard.jr9556@sbcglobal.net

Email:

-Your request for service on the item(s) will be avaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Reason For Return

M240 - BOLT LOCK SAFETY MODIFICATION

Service Request Section

PER CONSUMER THE GUN FIRES WHEN SAFETY IS PUSHED OFF.

Parts And Service Details

Material

Type

Description

Qty Needed

Warranty

Price Disc Amount

A6522191

Model:



THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

EJECT, 12 MISSING

T.A. dinky y set screws alt.

Mp. TPA, clean + Trest and.

BCP for TO LO +. rep. EJECT. AT

1/2 MOJIMMICOST Q

26/15: Cod. opposite & pol.

Sub Total: Est Sales Tax:

Grand Total:

.00 .00

\$.00

از.





