

Remington Arms Co., Inc.
Product Service
Legal Case #:8643

Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
301531	2/21/2013	2/22/2013	2/22/2013				

Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Reporter	The Country Store	---	The Country Sto	1177 N. Hwy 13	Chilhowee	MO	64733		W 660-885-8905 F 660-885-7590

Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015 Improper Maintenance		Unknown	
S FBC	Concern:1008 Fired on Bolt Closing			
C				

Dealer sent rifle in for consumer. Dealer's note stated "has had trigger replaced at Remington Warranty Center, Carl's Gun Shop in MO, will still fire upon closing bolt very entermittently as per customer". df

Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	n/a	6847587	AZ	3/1/1975
Date Purchased	Where Purchased	Accessories	Original Owner			
	SOUTHERN GUN DIST MIAMI FLA	SCOPE BASE	U			

CONCERN:FBC

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV
Per Ilion - Quote to repair under BLM						
	Repair/Replacement Cost	Repair/Replacement Date				
	\$29					

2/25/13: Per Ilion - TA has dried & sticky lube residue causing parts to work sluggish, can offer to replace TA, clean & test under BLM - quote. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment
Examination	Examiner		B.TRAVIS
	Exam Date		2/22/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4015	Improper Maintenance	CONSUMER STATES THAT THE SAFETY WAS CUT OFF AT AN RARC IN MO.
Barrel	Description		22" 3006 SPRG
	Date Code		AZ
	Bore Plugged	False	
	Bulged	False	
	Fired	False	

	Fired while Obstructed		
	Muzzle/Crown Condition	Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Not Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description		BOLT LOCK SAFETY
	Function	Like new; Functioning	
Sear	Lift	---Select---	.006
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Not Functioning	DIRTY,STICKY PARTS WORK SLUGGISH WILL FOLLOW DOWN
	Pull	---Select---	7#
	Altered	False	SEALANT PRESANT
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		SCOPE BASE

"The Country Store"

1177 N. Hwy 13, Chilhowee, MO 64733-9509 • 660-885-8905 • FAX 885-7590

22"
AZ 3/75
7#
.006

Customer Name: Richard Gillespie

Order 1339

Address: _____

Date 1-17-13

City & State: _____ Zip 8643

Phone: _____ Contact: _____

Salesman: _____ Cash ☐
Charge ☐
Credit ☐

Quantity	Number	Description	Size	Price	Net	Total
		<u>Remington 700 ADL 3006</u>				
		<u>sn # 6847587</u>				
		<u>HAS HAD Trigger Replaced Under Recall At Remington Warranty Rep</u>				
		<u>Station MO. Carls Gun Shop Will Still Fire Upon</u>				
		<u>Closing of Bolt Vary Intermittently As per Customer</u>				

NOTICE: Terms Net 10 days - a 1 1/2% Finance Charge will be added per month on past due invoices. There will be a \$25.00 Returned Check fee.

We Accept
Discover
Visa
MasterCard

Thank You

We appreciate your business

Sub Total
State Sales Tax
Total Amount Due \$

Serial Number:

6847587

Model: **700**



RE00301531

RECEIVED
FEB 25 2013

BY: _____

FBC

T.A. has a dried + sticky lube residue causing parts to work sluggish. can often to up. TPA, clean + test und. BLP Con 20 +

Q





