Remington Arms Co., Inc. Product Service Legal Case #:8650

Case Information

RE# **Date Opened** Date Opened(PS) **Date Closed Incident Date** Pre Lit Obsolete 301809 2/22/2013 2/25/2013 2/25/2013

Customer Information

Type Business First Name Last Name Street City State Zip Age Contact W 318-388-3788

Reporter Tyner-Petrus Hdwe Stores

Tyner-Petrus Hd 3000 Breard St Monroe LA 71201

E bill@tpoutdoors.com

Incident Information

Medical Medical Repair Est. Claims Codes Treatment Status

ΡĪ

PD Will fire when you push the bolt forward

As received Follows Down

Unknown

and lock it closed

Concern:1008 Fired on Bolt Closing

C

2/28/13 Per letter with rifle, this is a new gun that has not been sold yet. When you bolt the gun with the safety off the sear does not engage. Will fire when you push the bolt forward and lock it closed. If the safety is on and you bolt it the safety works ok.cm

Firearm Information

Mfg. Remington

Type CF/BA

Model/Ga. 700/308 WIN

SKU 25739

Bbl. Serial RR85402A XG

DOM

12/19/2012 10:32:23 AM

Date Purchased

Where Purchased HORTON DIST CO INC * LEW Accessories

Original Owner U

CONCERN:SEAR NOT ENGAGING WITH SAFE OFF

Ammunition Information - None Defined Other Products Information - None Defined Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date

Reimbursement

Cash Settlement Reim. Date Cash Date

APV

Replace TPA, check over and test fire at no charge

Repair/Replacement Repair/Replacement Cost Date

49.81

2/28/2013

2/28/13 Per Ilion, sear binds on side plates. Replace TPA, check over and test fire at no charge.cm

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment	
Examination	Examiner		B.TRAVIS	
	Exam Date		2/25/2013	
	Product Type		RF	
	Action Type		A	
	Assigned To		S.NICHOLS	╗
Cause	4054	As received Follows Down	SEAR BINDS ON SIDEPLATES	
Barrel	Description		20" 308 WIN HB FL	
	Date Code		OG	
	Bore Plugged	False		
	Bulged	False		
	Fired	False		
			und	

http://cps03ap13:200/psaapp/PrintDisplay.aspx?ID=8650&Type=Case

2/28/2013

PrintDisplay Page 2 of 2

	Fired while Obstructed		
	Muzzle/Crown Condition	Like new; Functioning]
Bolt	Firing Pin	Like new; Functioning]
	Shroud	Like new; Functioning	
	Face	Like new; Functioning	
	Handle	Like new; Functioning	
	Stop	Like new; Not Functioning	BINDS
	Condition	Like new; Functioning	
Extractor	Cut Condition	Like new; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Like new; Functioning	
	Notch Condition	Select	
	Exterior Condition	Like new; Not Functioning	
Overall	Stock Condition	Like new; Functioning	
	Fore End Condition	Select	
	Condition	Like new; Functioning	
Receiver	Bulged	False	
Safety	Description		STANDARD SAFETY
	Function	Like new; Functioning	
Sear	Lift	Select	N/A
	Notch	Like new; Functioning	
	Tests	Test Fired	False
Feeding Test] resis	False	<u> </u>
Trigger	Condition	Like new; Not Functioning	SEAR BIND TO SIDEPLATES WILL FOLLOW DOWN
	Pull	Select	3.5#
	Altered	False	40X TPA,SEALANT PRESANT
	Sub-Assembly	M/700 Non-Bolt Lock	

TYNER-PETRUS HARDWARE STORES



3000 Breard Street • Monroe, LA 71201 318-388-3788 • Fax 318-388-0911 bill@tpoutdoors.com SPEED-LETTER

(This letter, a copy of which is in our files, is sent to you in writing, so as to get our message into your hands without the delay occasioned by regular office routine.)

customer Service Det.	
TO Remington Arms INC.	Date 02/18/2013
14 Hofler Ave.	Subject
IL ION, N, Y.	
Please find encloses	I (1) Dre Rem 700 LTR,
cal. 300 win, serial # R.	
board new rolle that &	<i>- 1</i> 7
The problem with it	in that when you
bolt the gun with i	the salter off the
sear does not engage.	When you push the bolt
forward and lack it	bred the gun will
live If the safter is	on and you bolt it
the safter works ok	= Please check + repair.
	Thanks.
	Jim Mikon Gun Dept. Mgs

Serial Number:	RR85402A
	IVIOQEI: / 00
	RE00301809

Separ BINDS ON SIdephates.

Apr. TPA, check over + 705T

Fine at N/c

WARRANTY

FEB 26 2013

BY:









