

Remington Arms Co., Inc.  
Product Service  
Legal Case #:9732

## Case Information

RE#	Date Opened	Date Opened(PS)	Date Closed	Incident Date	Pre Lit	Lit	Obsolete
331732	12/20/2013	12/23/2013	12/23/2013				

## Customer Information

Type	Business	First Name	Last Name	Street	City	State	Zip	Age	Contact
Incident		Fred	Venditti	108 Tyrolia Dr	Monroeville	PA	15146		H (724) 327-6583 E fvenditti@comcast.net

## Incident Information

Claims	Codes	Repair Est.	Medical Treatment	Medical Status
PI				
PD	Cause:4015	Improper Maintenance		
S FSR	Concern:1007	Fired on Safe Release	Unknown	
C				

Per SR00071153 Service Request Section, customer states that the 700 went off when the safety was engaged and would like to have the bolt lock changed out. jbi

## Firearm Information

Mfg.	Type	Model/Ga.	SKU	Serial	Bbl.	DOM
Remington	CF/BA	700/3006 SPRG	N/A	6282173	ES	10/1/1969
Date Purchased	Where Purchased	Accessories	Original Owner			
	OSCAR ROB PITTS PA	BOTTOM HALF SEE THRU BASE	U			

CONCERN: FSR

Ammunition Information - None Defined

Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement	Release of Claims	Release Date	Reimbursement	Cash Settlement	Reim. Date APV	Cash Date APV

Per Ilion, quote  
to repair BLM

Repair/Replacement Cost	Repair/Replacement Date
\$27	

1/3/14: Per Ilion, "could not duplicate concern. trigger assembly dirty and sticky, trigger is not returning properly. replace trigger assembly, check over and test fire under bolt lock program for \$20.00 + shipping." jbi

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment

Examination	Examiner	B.TRAVIS	
	Exam Date	12/23/2013	
	Product Type	RF	
	Action Type	A	
	Assigned To	S.NICHOLS	
Cause	4015	Improper Maintenance	
Barrel	Description	22" 3006 SPRG	
	Date Code	ES	
	Bore Plugged	False	
	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
Bolt	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
Extractor	Condition	Slightly Worn; Functioning	
	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
Locking	Block Condition	---Select---	
	Lug Condition	Slightly Worn; Functioning	
	Notch Condition	---Select---	
Overall	Exterior Condition	Slightly Worn; Functioning	
	Stock Condition	Slightly Worn; Functioning	
	Fore End Condition	---Select---	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Safety	Description	BOLT LOCK SAFETY	
	Function	Like new; Functioning	
	Lift	---Select---	.007
		Slightly Worn;	

Sear	Notch	Functioning	
	Tests	Test Fired	False
Feeding Test		False	
Trigger	Condition	Slightly Worn; Functioning	DIRTY,STICKY TRIG NOT RETURNING
	Pull	---Select---	5.5#
	Altered	False	SEALANT PRESANT
	Sub-Assembly	M/700 Bolt Lock	
Non-Remington Components	Description		BOTTOM HALF SEE THRU BASE

# Quotation

Remington Service

PO Box 700

Madison, NC 27025-0700

# Estimating Report

Parts and Repairs: P:(800) 243-9700/F:(336) 548-7801

www.remington.com

Page: 1

**ALL PRICES QUOTED ARE IN EXCHANGE FOR REPLACED PARTS.**

THIS IS NOT AN INVOICE. THIS IS AN ESTIMATE TO REPAIR, RECONDITION, OR REPLACE THE ITEM(S) DESCRIBED BELOW. IF THIS IS SATISFACTORY, PLEASE APPROVE BY SIGNING BELOW AND RETURNING TO THE ABOVE ADDRESS. REPAIR TO TAKE APPROXIMATELY (6) WEEKS AFTER RECEIPT OF APPROVAL. IF WE DO NOT RECEIVE YOUR APPROVAL IN 21 DAYS, WE WILL RETURN THE ITEM(S) AS RECEIVED, POSTAGE DUE.

Remington disclaims all warranties concerning legality of a firearm's configuration under applicable state, county & local laws or regulations. Consumers are advised to check their local laws to determine whether certain firearm features are lawful.

**Customer:**

FRED VENDITTI  
108 TYROLIA DR  
MONROEVILLE, PA 15146 US

**Item Return To:**

FRED VENDITTI  
108 TYROLIA DR  
MONROEVILLE, PA 15146 US

**Please Circle One:**

VISA MC DISCOVER Card No. \_\_\_\_\_ Exp. Date \_\_\_\_\_  
Open Account: R \_\_\_\_\_ PO Number: \_\_\_\_\_

Approval Signature: \_\_\_\_\_ Date: \_\_\_\_\_  
Daytime Phone: (\_\_\_\_) \_\_\_\_\_ Time to Call: \_\_\_\_\_

☐ If you desire any change, please use the reverse side for your comments and mark this box.

<b>Repair Number</b>	<b>Serial Number / Description</b>	<b>Date Received:</b>	12/20/2013
RE00331732	6282173	<b>Estimate Date:</b>	12/23/2013
	Model 700 Center Fire Caliber: 30-06 SPRG	<b>Date Printed:</b>	1/20/2014

**Problems**

<b>Reported</b>	<b>Found</b>
R014 - FORWARD TO PRODUCT SERVICE FOR INSPECTION	R014 - FORWARD TO PRODUCT SERVICE FOR INSPECTION
U008 - BOLT LOCK SAFETY MODIFICATION	U008 - BOLT LOCK SAFETY MODIFICATION

**Technician Comments**

could not duplicate concern. trigger assembly dirty and sticky, trigger is not returning properly. replace trigger assembly, check over and test fire under bolt lock program for \$20.00 + shipping

ESTIMATE (note: C.O.D./Shipping and Handling Charges are NOT Included in this Quote.)							
Material	Type	Description	Qty Needed	Warranty	Qty From Inv	Price	Disc Amount
F305570B	Part	X-MARK PRO 700 TRIG ASSB RH BLACK (OS)	1	Warranty	1	.00	0 .00
4000114	Service	GR-SHIPING & HANDLING (GUN REPAIR)	1	Billable	1	17.00	0 17.00
4000116	Service	GR-LABOR	20	Billable	20	1.00	0 20.00
4000119	Service	GR-TEST	1	Warranty	1	.00	0 .00

**Sub Total:** 37.00

**Est Sales Tax:** 2.22

**Grand Total:** \$39.22

5. 1999年12月1日，某公司因故被吊销营业执照，其债权债务由谁承担？

**www.Remington.com**

This document is a summary of your request for service. Please review the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSURE

22"  
ES 10/6  
5.5  
1007

-Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

## M240 - BOLT LOCK SAFETY MODIFICATION

CUSTOMER STATES THAT THE 700 WENT OFF WHEN THE SAFETY WAS ENGAGED AND WOULD LIKE TO HAVE THE BOLT LOCK CHANGED OUT

Price	Disc	Amount
-------	------	--------

BY: \_\_\_\_\_

could not Lync connect  
T.A. dirty + sticky. Tring  
Not net. properly. Rep. T.A.  
check over + test and BCP  
for 20 +

**THIS IS NOT AN INVOICE.** This is a pre-estimate to repair, recondition, or replace the

८

**Grand Total:** \$ .00











