Remington Arms Co., Inc. Product Service Legal Case #:9035

Case Information

RE# Date Opened Date Opened(PS) Date Closed Incident Date Pre Lit Lit Obsolete 314607 7/3/2013 7/15/2013 7/15/2013

Customer Information

Type Business First Last Name Street City State Zip Age Contact

Name Dast Name Street City State Zip Age Contact

W 406-676-4100

Reporter Westland Seed Linda Seed Butte Rd Ronan MT 59864 E jay.westland@ronan.net

Incident Information

Claims Codes Repair Est. Medical Treatment Medical Status

PΙ

PD Cause:4038 Could Not Duplicate Concern

Unknown

S FSR Concern:1007 Fired on Safe Release

C

SR00054520. Service Request Section: Per Consumer, Gun went off when safety was pushed off. jbi

Firearm Information

Mfg.TypeModel/Ga.SKUSerialBbl.DOMRemingtonCF/BA700/6MM REMn/aA6661942 DQ 9/1/1978

Date Purchased Where Purchased Accessories Original Owner

BOB WARD/SONS MISSOULA MT U

CONCERN:FSR

Ammunition Information - None Defined Other Products Information - None Defined

Settlement

Remington/700/CF/BA

Settlement Release of Claims Release Date Reimbursement Cash Date APV APV

Per Ilion, quote to repair BLM

Repair/Replacement Repair/Replacement Cost Date

\$29

7/16/13: Per Ilion, Could not dup. concern. T.A. very dirty and sticky. Replace TPA, clean and test under BLP-quote. jbi I called store & spoke w/Jay. He will call back with CC# to pay quote. df 7/22/13: I called store & spoke w/Lana. She apprvd & pd by CC#. df

Examination[Remington/CF/BA]

Part	Sub-Part	Code	Comment		

http://cps03sp01.remington.com:99/Remington_PSA/PrintDisplay.aspx?ID=9035&Type=... 7/22/2013

Examination	Examiner		B.TRAVIS
	Exam Date		7/15/2013
	Product Type		RF
	Action Type		A
	Assigned To		S.NICHOLS
Cause	4038	Could Not Duplicate Concern	
	Description		22" 6MM REM
	Date Code		DQ
	Bore Plugged	False	
Barrel	Bulged	False	
	Fired	False	
	Fired while Obstructed		
	Muzzle/Crown Condition	Slightly Worn; Functioning	
	Firing Pin	Slightly Worn; Functioning	
	Shroud	Slightly Worn; Functioning	
Bolt	Face	Slightly Worn; Functioning	
	Handle	Slightly Worn; Functioning	
	Stop	Slightly Worn; Not Functioning	BINDS
	Condition	Slightly Worn; Functioning	
Extractor	Cut Condition	Slightly Worn; Functioning	
	Ext/Eject Test	False	
	Block Condition	Select	
Locking	Lug Condition	Slightly Worn; Functioning	
_	Notch Condition	Select	
	Exterior Condition	Slightly Worn; Functioning	
Overall	Stock Condition	Worn; Functioning	
	Fore End Condition	Select	
Receiver	Condition	Slightly Worn; Functioning	
	Bulged	False	
Cafata	Description		BOLT LOCK SAFETY
Safety	Function	Like new; Functioning	
Sear	Lift	Select	.010
	Notch	Slightly Worn; Functioning	
	Tests	Test Fired	False
Feeding Test	10303	False	
Trigger	Condition	Slightly Worn; Functioning	VERY DIRTY,STICKY
	Pull	Select	4.5#
	Altered	False	SEALANT PRESANT
	Sub-Assembly	M/700 Bolt Lock	

Quotation

Remington Service PO Box 700

Madison, NC 27025-0700

Estimating Report

Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

All PRICES QUOTED ARE IN EXCHANGE FOR REPLACED PARTS.

THIS IS NOT AN INVOICE. THIS IS AN ESTIMATE TO REPAIR, RECONDITION, OR REPLACE THE ITEM(S) DESCRIBED BELOW. IF THIS IS SATISFACTORY, PLEASE APPROVE BY SIGNING BELOW AND RETURNING TO THE ABOVE ADDRESS. REPAIR TO TAKE APPROXIMATELY (6) WEEKS AFTER RECEIPT OF APPROVAL. IF WE DO NOT RECEIVE YOUR APPROVAL IN 21 DAYS, WE WILL RETURN THE ITEM(S) AS RECEIVED, POSTAGE DUE.

Repair Number RE00314607	A66	ial Number / Description 661942	200			Date Rec Estimate	Date:	07/03/2 07/16/2	013
	Mod	del 700 Center Fire Caliber: 6 MM	REM			Date Pri	nte d :	37/17/2	013
Customer: WESTLAND ATTN: LIND 36272 ROUN RONAN, MT	A D BUTTE RD				Return To: WESTLAND S ATTN: LINDA 36272 ROUNE RONAN, MT	BUTTE RD			
Please Circle One: VISA MC DISCOVER Card No Exp.Date									
Open Account	t: R	PO Number	г:						
Approval Signatu Daytime Phone	re: e: ()_		Time t	o Cail:		Date:			
		lease use the reverse side for your co	omment	s and mark t					
			Pro	olems					
Reported M123 - FORWARD TO PRODUCT SERVICE FOR INSPECTION M240 - BOLT LOCK SAFETY MODIFICATION M240 - BOLT LOCK SAFETY MODIFICATION M240 - BOLT LOCK SAFETY MODIFICATION Found M123 - FORWARD TO PRODUCT SERVICE FOR INSPECTION M238 - CLEAN & INSPECT (SAFETY PROGRAM ONLY) M240 - BOLT LOCK SAFETY MODIFICATION									
		Tec	chnician	Comment					
could not duplicate hipping		ger assembly very dirty and sticky.re	•	-	••			m for \$3	20.00 + s
Material	Type	FIMATE (note: C.O.D./Shipping a Description	ind Han	dling Char Qt Need	y Warranty	ded in this Qu Qty From Inv	iote.) Price	Disc	Amount
F305570B 4000114 4000116 4000119	Part Service Service Service	X-MARK PRO 700 TRIG ASSB R GR-SHIPPING & HANDLING (G GR-LABOR GR-TEST			Billable Billable	1 1 20 1	.00 17.00 1.00 .00	0 0 0	.00 17.00 20.00 .00
					Paid 7/22/13	df			
						Est 9	Total: Sales Tax:		37.00
						Grai	nd Total:		\$37.00

Madison NC 27025-0700

Parts and Repairs: P:800-243-9700/F:336-548-7801

www.Remington.com

This document is a summary of your request for service. Please seview the document for accuracy and to insure the services you are requesting are noted. This information will serve as a guideline for our Service Department to address your specific concerns and provide you with accurate and complete service. ENCLOSE THIS DOCUMENT WITH YOUR RETURN.

z2"

Serial Number / Description Service Request Number SR00054520

A6661942 Model R5858

Customer: WESTLAND SEED

ATTN: LINDA 36272 ROUND BUTTE RD RONAN, MT 59864 US Email: jay.westland@ronan.net

Date of Request: Date Printed:

06/07/2013 06/07/2013

Destination: Arms Services 14 Hoefler Ave Dion, NY 13357 US

-Your request for service on the item(s) will be evaluated by our repairman to determine if it is covered under our warranty policy. If it is your firearm will be repaired and returned. If not, you will be contacted with an estimate before work is performed.

Resson For Return

M240 - BOLT LOCK SAFETY MODIFICATION

Service Request Section

PER CONSUMER, GUN WENT OFF WHEN SAFETY WAS PUSHED OFF.

Parts And Service Details 15. Material

Type

Description

Warranty

Disc

Model:



Could not dup. conce an. T.A. very dunky isticky. hep. TPA, cleant rust und. BUP for Zo +

THIS IS NOT AN INVOICE. This is a pre-estimate to repair, recondition, or replace the

Sub Total: Est Sales Tax: .00 .00

Grand Total:

\$.00







