

MODEL 700 SAFETY EVALUATION

SERIAL NO. 6718369 - 30-06 E. Sliwa

As received all functions work correctly. The rifle shows moderate usage.

- 1. No signs of rubbing in Trigger Guard.**
- 2. No signs of interference in Stock.**
- 3. Visible signs of wet oil throughout assembly.**
- 4. Seals on adjustment screws unaltered from the factory.**
- 5. Slight mis-shape on the rear of Sear Safety Cam.**
- 6. Trigger Assembly has axially (sideways) play on Receiver Assembly Pins. Play perpendicular to bore of rifle.**
- 7. Sear not oily - inside of Housing has thin coat of oil - not excessive.**
- 8. Definite burrs on Sear Safety Cam where part was densified on the Firing Pin contact surface.**
- 9. Engagement of Sear Connector - good.**
- 10. Top of Connector looks good.**
- 11. Corner of Sear Safety Cam ok.**
- 12. Housing shows slight deformation directly above assembly pin hole. Could have been done by assembler spreading housing.**
- 13. Detent ball working in correct position.**
- 14. Wear marks in Trigger Housing where Sear (burr on Sear) was scrubbing. Could see where this could cause follow down but not fire off safe condition.**

F. E. Martin/nl