

DON'T SAY IT-WRITE IT

XC-J.W. DOWDY

To L.B. BessetDate 5-31-81From L.B. WilcoxRe: M17 E.S.B.

BOTH BOLTS HAVE A NOTICEABLE BURR AROUND THE EJECTOR HOLE THAT SHAVES BRASS FROM THE SHELL HEAD & DEPOSITS IT IN THE HOLE BINDING THE EJECTOR. ALSO SER. # 3137 HAS THE WRONG EJECTOR SPRING IN IT, AND CALLS FOR A MIN. FREE LENGTH OF 1.100 IN. THIS SPRING IS AP. 920. THE SPRING HAD BEEN CUT OFF. I HAD IT RE-ASSEMBLED WITH A FULL LENGTH SPRING & IT WORKED FINE. THE BURR FROM SER. # 3137 WAS NOT SCRAPED AT THE HEADING-408, & THE OTHER ONE WAS DONE IMPROPERLY. BOTH HOLE DIAMETERS WERE O.K.

5-31-81
"DON'T TAKE A CHANCE, THINK SAFETY IN ADVANCE"