

RECEIVING AND ESTIMATING REPORT

INITIAL		CUSTOMER ORDER NO.		COMMENTS					
IJM		87782							
DATE RECEIVED	DATE OPENED	DATE CODE	SERIAL NUMBER	MODEL AND GRADE		ORDER			
12/26/91	03/04/91	XZ 12-75	A6225033	700 6MM		BDL/VAR		R 91-0613	
ACCESSORIES		SCOPE BASE							

FROM:

AHLMAN'S
ROUTE 1 BOX 20
MORRISTOWN

MN 55052

SHIP TO:

AHLMAN'S
ROUTE 1 BOX 20
MORRISTOWN

MN 55052

COUNT NUMBER	ACCOUNT NUMBER N/C	WRITE ☐	CLEAN/TEST	PROM. DATE	ESTIMATED	VIA
					3-19-91	UPS

PAIR CHARGE	TAX	INSURANCE	UPS	PARCEL POST	TOTAL
-------------	-----	-----------	-----	-------------	-------

GUN CONDITION:

☐ NEW☐ SLIGHTLY WORN☐ VERY WORN☐ MISUSED☐ MARRED

CUSTOMER'S REQUEST

Gun will fire when safety is opened
or shell is chambered.

MAIN FAULT

1) Trigger assembly is contaminated with gummy residue; trigger and
main safety cam sticking to side plate, as received. Bolt handle same
substance on it. 2) Trigger pull has been adjusted to 2 1/2 pounds (below
300 grs) out of factory, as evidenced by red sealant on adjustment
screw. Rifle would not cock as received.

RTS

Offer to
clean and re-adjust trigger assembly to
Remington spec. If possible. Or, we
can install a new trigger assembly
at a minimal cost, as a gesture of
good-will, if it will better restore
confidence in the rifle.

REPAIRMAN	PROOF	CLEAN	TEST	TARGET	PATTERN
N.B.S.					
GALLERY TESTER	DATE	DATE	DATE	DATE	DATE

OFFICE COPY

RD6925 REV. 7/90