

Remington.



bcc: Arms Service
R-89-06488
Make repairs at no-charge
Install new trigger assembly
Bill Ericson
Jim Hutton

REMINGTON ARMS COMPANY, INC.

SPORTING ARMS-AMMUNITION-TARGETS-TRAPS

ILION, NEW YORK 13357

TELEPHONE (315) 894-9961

March 8, 1989

Allison & Carey Gun Works
10218 S.E. Powell Blvd.
Portland, Oregon 97266-0000

Dear Sir:

Our experts have completed the examination of the Model 700 ADL 25/06 caliber rifle, serial number 6494269, that you returned to us with the alleged complaint that the rifle fired when safety is taken off.

The returned firearm, which was produced in November of 1971, has been thoroughly examined and found to contain our high-pressure proof test, gallery test, and final inspection stampings, indicating that it had successfully passed all necessary tests and inspection prior to being shipped from our factory.

The general condition of the rifle appeared to be good; in going over the individual parts, we found headspace, recoil shoulders and chamber all to be normal.

Examination of the rifle and trigger assembly could not duplicate the reported malfunction. However, removal of the barrel-action from the stock assembly revealed that the inletting of the stock, the trigger assembly, and bolt stop was wet with excessive oil. In future use, we strongly advise that oil be used sparingly and not let accumulate in or on the trigger assembly, as this condition could adversely affect the operation of the trigger assembly.

As a gesture of good-will, we are replacing the complete trigger assembly at no-charge.