

P. 1/53 GUN EXAMINATION REPORT NUMBER: 493 MODEL: 7100 919
 GENERAL CONDITION: FAIR R #: 18979
 OUTSIDE WORK: SAFETY APPEARS TO HAVE DATE: 7-23-81
BEEN REMOVED + REASSEMBLED WRONG FROM: ANCHOR MACHINE
4217 CANYON DR
AMARILLO TEX
 FIRE ARM TYPE: NOT KNOWN GUN #: A6407055
 & CONDITION: _____ CODE: LO-2-77
 PROCP: U INSP.: 62 TEST: 70 GA./CAL.: 243
 HEADING: OK CHECKED BY: M-HARDY
 BRANCH OPENING: OK APPROVED: GAL 8/2/81
 RECOIL SHOULDERS: OK APPROVED: RL 8/2/81
 CHAMBER: OK APPROVED: RL 8/2/81
 TEST: _____ APPROVED: RL 8/2/81
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: RL 8/2/81
BRIGHT METAL ON BBL. SLIGHT MARKS ON STOCK
SAFETY ARM BROKEN AT THUMB PIECE
SAFETY PIVOT PIN AND SAFETY PIVOT PIN
RETAINER WASHER REVERSED
 COMPLAINT: FIRES ON CLOSING OF BOLT
 INCIDENT: _____
 COMMENTS: Unable to duplicate customer complaint.
5 1/2" Tracer Pull .0095" seen with. Gun passes tick test.
Replace fire control.