

Rev. 2-15-61

P.I. YES GUN EXAMINATION REPORT NUMBER: 686 MODEL: 788
 GENERAL CONDITION: FAIR - SLIGHT RUST R #: 16125
 OUTSIDE WORK: SIGHTS REMOVED DATE: 6-17-82
SCOPE ADDED FROM: ANDERSON VS
 FIRED AMMO TYPE: NOT KNOWN REMINGTON
 & CONDITION: _____ GUN #: B6021478
 PROOF: H INSP.: 77 TEST: 61 CODE: PQ-11-78
 HEADING: OK GA./CAL.: 6MM
 BREECH OPENING: OK CHECKED BY: M. HARDY
 RECOIL SHOULDERS: OK APPROVED: 9/21/82
 CHAMBER: OK APPROVED: P.M. 7/21/82
 TEST: _____ APPROVED: 7/2/82
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

BBL MARKED. STOCK MARKED. RUST ON BBL
MAG BOX + TRIG GUARD - Takedown screw slots
damaged. Stock glass bedded in bbl groove.

COMPLAINT: CLAIMING DEFECTIVE SAFETY + TRIGGER MECHANISM

INCIDENT: _____

COMMENTS: Sear Spring shortened 3 coils, sear
repaired by use of brazing material near
hole. This work done outside factory.
The above alterations to this gun will cause gun
to malfunction as follows: If trigger pulled with
safety on, then safety released, gun will fire.