RD-6542-1 Rev. 2-15-61	
P.I. VEJ GUN EXAMINATION REPORT NUMBER:	192 MODEL: 700 804
ENERAL CONDITION: GOOD	R#: 32/34
OUTSIDE WORK: NONE VISIBLE, L	-ETTER DATE: 12-4-79
STATES SHEETY AFPLACED	SOUSATEROM: JC PENNEY
IRED AMMO TYPE: NOT KYOWV	5447 LAME CITY
& CONDITION: NO SHELLS REC. B.	•
PROOF: $(f \in P)$ INSP.: U TEST:	64 ODE: ナンニ 3-79
EADING: OK	
REECH OPENING:	CHECKED BY: 101- 14 4 4 5 3 3
ECOIL SHOULDERS:	APPROVED: 944 12/2//
HAMBER:	APPROVED:
est:	APPROVED: 2 /2 /2 -2/- 74
MPLAINT: FIRED WHEN 542	TE 10 4 2 PELE 42 50
NCIDENT:	
	<u>*</u>
MMENTS: fille possed trick tall	Trigger full 4/5#
un stile to displicate cus	etimes complaint out
A Stock. Replace trigger.	assembly & bolt at
Uno charge to austiner.	
3	
Customer admits to ant	

No response to this letter on of 8/1982

January 22, 1980

J.C. Penney Company, Inc. 213 South Main St. Salt Lake City, Utah 84111

Gentlemen:

Examination has been completed on your customer's Model 700 BDL 7mm Rem. Mag. caliber rifle, serial number A6739101, which allegedly fired when the safety was pushed to the "fire" position.

Our experts thoroughly examined the rifle and trigger assembly and could not duplicate the incident that was reported. All parts tolerances and dimensions were found to be normal, including sear-connector engagement. Also, factory seals were intact on the trigger adjustment screws, indicating no alterations were made to the trigger outside our company.

Based on our findings, Remington Arms Company, Inc., cannot accept liability or responsibility for this incident. We can only assume that as the safety was pushed to the "fire" position, contact was made with the trigger. When the safety is in the "on safe" position, the sear is lifted off of the trigger connector and very little effort is required to pull the trigger rearward unknowingly, thus taking the trigger out from under the sear. If the trigger is held in the rearward position while the safety lever is moved to the "fire" position, the sear having no trigger to rest on drops away from the notch in the striker as soon as the disconnector is moved away by the safety lever, thus causing the striker to move forward and the gun to fire.

This happens so fast that the shooter does not realize he has pulled the trigger and he attributes the "accidental" firing to gun mal-function.

bcc: E.F. Barrett

E.G. Larson

J.E. Preiser

J.H. Chisnall

R.B. Sperling

D.F. Polley

R-32134

January 22, 1980

-2-

We trust that we have clarified the circumstances that could possibly have caused the accidental firing. The firearm can be returned as received, of, if you so desire and as a gesture of good will, even though there is nothing wrong with the present trigger assembly, we can replace it with another assembly at no charge. We will await your decision and reply.

Thank you for having afforded us the opportunity to examine the rifle and to be of service.

Sincerely,

J.A. Stekl, Supervisor Firearms Product Service

JAS: tpp

10-07-2-1 164. 2-17-01	
P.I. YES GUN EXAMINATION REPORT NUMBER: 192	MODEL: 700 BDL
GENERAL CONDITION: GOOD	R#: 32/34
OUTSIDE WORK: NONE VISIBLE, LETTER	DATE: 12-4/- 79
STATES SAFETY AFPLEASED OF GOUSE	FROM: OCPEYYEY
FIRED AMMO TYPE: NOT KNOWN	SALT LAKE CITY UT
& CONDITION: NO SHELLS REC. BY ME	GUN # : A 6 7 3 9 10 1
PROOP: $(\beta \in P)$: INSP.: U TEST: 64	ODE: ナリニ 3-79
HEADING: OK	GA./CAL.: 7MM 11+G.
BREECH OPENING: 0 K	CHECKED BY: M-HARDY
RECOIL SHOULDERS: 0 K	APPROVED: 44 12/21/29
CHAMBER:	APPROVED:
TEST:	APPROVED: 12-21-79
COMPLAINT: FIRED WHEN SHEE WAD	MELE KIED
INCIDENT:	
COMMENTS: fille passed truck test, Twigger	Full 4/3#
•	
un sele to duplicate customer co	replaint out
•	replaint out
un sole to duplicate customer co	anglaint out