

P.I. No GUN EXAMINATION REPORT NUMBER: _____ MODEL: 6601
 GENERAL CONDITION: GOOD R #: 001995
 OUTSIDE WORK: SCOPE MOUNTED DATE: 1-31-72
 FROM: BONITZ BROG. INC.
 FIRED AMMO TYPE: - HARRISBURG. PA.
 & CONDITION: _____ GUN #: 127052
 PROOF: R.E.P. INSP.: U TEST: 13 CODE: ER=10/62
 HEADING: - GK./CAL.: 6.5MM REM. MAG.
 BREECH OPENING: - CHECKED BY: C. PROSSER
 RECOIL SHOULDERS: O.K. APPROVED: _____
 CHAMBER: O.K. APPROVED: _____
 TEST: No APPROVED: _____
 COMPONENT CONDITION: (Damaged, Broken, Old Style) APPROVED: _____

RUST AROUND TRIGGER AND BETWEEN BOLT FALLER,
FIRING PIN & BOLT ASSEMBLY. TRIGGER FULL 3 LBS.
(SPEC. 4 TO 6) ENGAGEMENT .010 (SPEC. .020 MIN.)

COMPLAINT: "FIRED TWICE WHEN SAFETY WAS PUT IN OFF POSITION"

INCIDENT: FOLLOW DOWN.

COMMENTS: AS RECEIVED, RUST IN FIRING PIN ASSEMBLY MADE IT
DIFFICULT TO CLOSE AND LOCK BOLT. FIRING PIN
WOULD NOT FALL. IT IS PROBABLE THAT THE RUST
AROUND THE TRIGGER COMBINED WITH UNDER MIN ENGAGE-
MENT & UNDER MIN. TRIGGER PULL, CAUSED THE TRIGGER-
CONNECTOR TO FAIL TO RETRACT WHEN PULLED WITH
THE SAFETY ON. RELEASING THE SAFETY ALLOWED
THE FIRING PIN TO FALL.